



## Avaya Solution & Interoperability Test Lab

---

# Application Notes for Avaya Aura® Communication Manager 8.0, Avaya Aura® Session Manager 8.0 and Avaya Session Border Controller for Enterprise 7.2 with AT&T IP Transfer Connect Service – Issue 1.0

## Abstract

These Application Notes describe the steps for configuring Avaya Aura® Communication Manager 8.0, Avaya Aura® Session Manager 8.0, and the Avaya Session Border Controller for Enterprise 7.2 with the AT&T IP Transfer Connect service using AT&T **AVPN** or **MIS/PNT** transport connections.

The AT&T IP Transfer Connect service is a service option available with the AT&T IP Toll Free service, and supports the rerouting of inbound toll-free calls to alternate destinations based upon SIP redirection messages from Avaya Aura® Communication Manager.

Note that these Application Notes are intended to supplement the separate document: *Application Notes for Avaya Aura® Communication Manager 8.0, Avaya Aura® Session Manager 8.0 and Avaya Session Border Controller for Enterprise 7.2 with AT&T IP Toll Free SIP Trunk Service – Issue 1.0*.

Readers should pay attention to **Section 2**, in particular the scope of testing as outlined in **Section 2.1** as well as the observations noted in **Section 2.2**, to ensure that their own use cases are adequately covered by this scope and results.

AT&T is a member of the Avaya DevConnect Service Provider program. Information in these Application Notes has been obtained through DevConnect compliance testing and additional technical discussions. Testing was conducted via the DevConnect Program at the Avaya Solution and Interoperability Test Lab.

## **TABLE OF CONTENTS**

1.	Introduction.....	3
2.	General Test Approach and Test Results.....	3
2.1.	Interoperability Compliance Testing.....	4
2.2.	Test Results .....	5
2.3.	Support .....	5
3.	Reference Configuration .....	6
3.1.	Illustrative Configuration Information .....	8
3.2.	Call Flows .....	9
3.2.1.	Basic Inbound Call.....	9
3.2.2.	302 Call Redirection .....	10
3.2.3.	Refer Call Redirection .....	11
3.2.4.	Refer Call Redirection – Error Handling .....	12
4.	Equipment and Software Validated .....	13
5.	Avaya Aura® Session Manager.....	14
5.1.	Dial Patterns .....	14
6.	Avaya Aura® Communication Manager .....	15
6.1.	System Parameters .....	15
6.2.	Trunks.....	17
6.3.	Inbound Call Routing .....	18
6.3.1.	Pre-Answer Redirection - 302 .....	18
6.3.2.	Post-Answer Redirection - Refer .....	19
7.	Avaya Session Border Controller for Enterprise .....	21
8.	Verification Steps.....	21
8.1.	Call Verification.....	21
8.2.	Protocol Traces.....	22
8.2.1.	302 Redirection.....	22
8.2.2.	Refer.....	23
9.	Conclusion .....	24
10.	References.....	25

# 1. Introduction

These Application Notes describe the steps for configuring Avaya Aura® Communication Manager 8.0, Avaya Aura® Session Manager 8.0, and the Avaya Session Border Controller for Enterprise 7.2, with the AT&T IP Transfer Connect service using AT&T AVPN or MIS/PNT transport connections<sup>1</sup>. The AT&T IP Transfer Connect (IPTC) service is a service option available with the AT&T IP Toll Free (IPTF) service and supports the rerouting of inbound toll-free calls to alternate<sup>2</sup> destinations based upon SIP redirection messages from Avaya Aura® Communication Manager.

The AT&T IP Transfer Connect service is typically used by enterprises that have multiple call centers that are separated geographically or otherwise not interconnected. Using Avaya Aura® Communication Manager SIP NCR feature, trunk-to-trunk routing of certain inbound calls at Avaya Aura® Communication Manager can be avoided by requesting that the AT&T network transfer the inbound caller to an alternate destination.

In addition, Communication Manager SIP User-to-User Information (UUI) feature can be utilized with the SIP NCR feature to transmit UUI within SIP signaling messages to the alternate destinations. This capability is used in conjunction with the Data Forwarding option of the AT&T IP Transfer Connect service to transmit a limited amount of call-related data between call centers to support enhanced, customer-friendly applications and/or support efficient use of call center resources. Examples of UUI data might include a customer account number obtained during a database query and the best service routing data exchanged between Communication Manager systems.

## 2. General Test Approach and Test Results

DevConnect Compliance Testing is conducted jointly by Avaya and DevConnect members. The jointly-defined test plan focuses on exercising APIs and/or standards-based interfaces pertinent to the interoperability of the tested products and their functionalities. DevConnect Compliance Testing is not intended to substitute full product performance or feature testing performed by DevConnect members, nor is it to be construed as an endorsement by Avaya of the suitability or completeness of a DevConnect member's solution.

The interoperability compliance testing focused on verifying call flows between IPTF and the Customer Premises Equipment (CPE) containing Communication Manager, Session Manager, and the Avaya SBCE (see **Section 3.2** for call flow examples). The test environment consisted of:

- A simulated enterprise with Communication Manager, Session Manager, System Manager (for Session Manager provisioning), Avaya SBCE, and various Avaya IP telephones (see **Section 3**).
- A laboratory version of the AT&T IP Transfer Connect service, to which the simulated enterprise was connected.

---

<sup>1</sup> MIS/PNT transport does not support compressed RTP (cRTP), however AVPN transport does support cRTP

<sup>2</sup> Note that this is NOT the same as the “Alternate Destination Routing (ADR)” service option available with the AT&T IP Toll Free service.

Avaya recommends our customers implement Avaya solutions using appropriate security and encryption capabilities enabled by our products. The testing referenced in this DevConnect Application Note included the enablement of supported encryption capabilities in the Avaya products. Readers should consult the appropriate Avaya product documentation for further information regarding security and encryption capabilities supported by those Avaya products.

Support for these security and encryption capabilities in any non-Avaya solution component is the responsibility of each individual vendor. Readers should consult the appropriate vendor-supplied product documentation for more information regarding those products.

For the testing associated with these Application Notes, the interface between Avaya systems and the AT&T Toll Free service did not include use of any specific encryption features as requested by AT&T.

## **2.1. Interoperability Compliance Testing**

The compliance testing was based on a test plan provided by AT&T, for the functionality required for certification as a solution supported on the AT&T network. Calls were made from the PSTN across the AT&T network, to the Avaya CPE. The following SIP trunking VoIP features were tested with the IPTC service:

- Inbound AT&T IP Transfer Connect service calls to Communication Manager VDNs, agents/telephones; utilizing G.729A codec (IPTC preferred codec). However, G.729B and G.711 codecs were tested as well.
- Avaya 96x1 IP telephones (H.323 and SIP) were used in Agent mode on Communication Manager.
- Inbound AT&T IP Transfer Connect service calls that are immediately redirected by a Communication Manager vector (pre-answer redirection) back to IPTC for redirection to an alternate destination.
- Inbound IPTC calls that are answered by a Communication Manager vector and then redirected (post-answer redirection) back to IPTC for redirection to an alternate destination.
- Redirected IPTC calls per above arriving on Communication Manager VDNs, agents, and phones (e.g., Communication Manager as the target party for the redirected calls).
- Recovery from unsuccessful post-answer redirection attempts per above due to busy or error conditions on the alternate destination.
- Verify reception of IPTC SIP Multipart/NSS headers, including SDP and XML content.
- Communication Manager features such as hold, resume, and local transfer.
- SIP OPTIONS messages used to monitor the health of the SIP trunks between the CPE and AT&T.
- Communication Manager NCR and SIP User-to-User Information (UII) capability, in conjunction with the Data Forwarding option of the AT&T IP Transfer Connect service, to transmit UII within SIP signaling messages to the alternate destinations.

## 2.2. Test Results

The test objectives stated in **Section 2.1**, with limitations as noted below, were verified.

1. **302 redirections and 180 Ringing** - The IP Transfer Connect service specifies that 18x responses should not be used in conjunction with 302 redirection calls. Therefore, ring back should not be specified in Communication Manager 302 redirection vectors (see **Section 6.3.1**).
2. **IP Transfer Connect service Landline/Mobility test cases could not be executed.** The AT&T supplied IP Transfer Connect test plan specifies test cases to verify the transmission of Landline/Mobility data by the IP Transfer Connect service. Due to network access issues, these test cases could not be executed.

## 2.3. Support

AT&T customers may obtain support for the AT&T IP Transfer Connect service by calling (800) 325-5555.

Avaya customers may obtain documentation and support for Avaya products by visiting <http://support.avaya.com>. In the United States, (866) GO-AVAYA (866-462-8292) provides access to overall sales and service support menus.


### 3. Reference Configuration

**Note** – Documents used to provision the test environment are listed in **Section 10**. In the following sections, references to these documents are indicated by the notation [x], where x is the document reference number.

**Note** – These Application Notes are intended to supplement the separate document: *Application Notes for Avaya Aura® Communication Manager 8.0, Avaya Aura® Session Manager 8.0 and Avaya Session Border Controller for Enterprise 7.2 with AT&T IP Toll Free SIP Trunk Service – Issue 1.0*. This document is listed in **Section 10** as reference document [13]. It is recommended that this AT&T IP Toll Free service document should be available as a reference during provisioning of the AT&T IP Transfer Connect service.

The reference configuration used in these Application Notes is shown in **Figure 1** and consists of several components:

- Communication Manager 8.0, System Manager 8.0, Session Manager 8.0, and the Avaya SBCE 7.2 are used in the reference configuration.
- Session Manager provides core SIP routing and integration services that enables communication between disparate SIP-enabled entities, e.g., PBXs, SIP proxies, gateways, adjuncts, trunks, applications, etc. across the enterprise. Avaya SIP endpoints register to Session Manager.
- System Manager provides a common administration interface for centralized management of all Session Manager instances in an enterprise.
- Communication Manager provides the voice communication services for a particular enterprise site. Avaya H.323 endpoints register to Communication Manager.
- An Avaya Media Gateway provides the physical interfaces and resources for Communication Manager. In the reference configuration, an Avaya G450 Media Gateway is used. This solution is extensible to other Avaya Media Gateways.
- Avaya desk telephones used are Avaya 96x1 Series IP Telephones (H.323 and SIP), and Avaya J100 Series IP Telephones (SIP).
- The Avaya SBCE provides SIP Session Border Controller (SBC) functionality, including address translation and SIP header manipulation between the IPTC service and the enterprise internal network.
- The IPTC service uses SIP over UDP to communicate with enterprise edge SIP devices, e.g., the Avaya SBCE. Session Manager may use SIP over UDP, TCP, or TLS to communicate with SIP network elements, e.g., the Avaya SBCE and Communication Manager. In the reference configuration, Session Manager uses SIP over TLS to communicate with the Avaya SBCE and Communication Manager.
- Inbound calls were placed from PSTN via the IPTC service, through the Avaya SBCE to Session Manager, which routes the call to Communication Manager. Communication Manager terminates the call to the appropriate agent/phone extension or redirects the call via 302 or Refer.

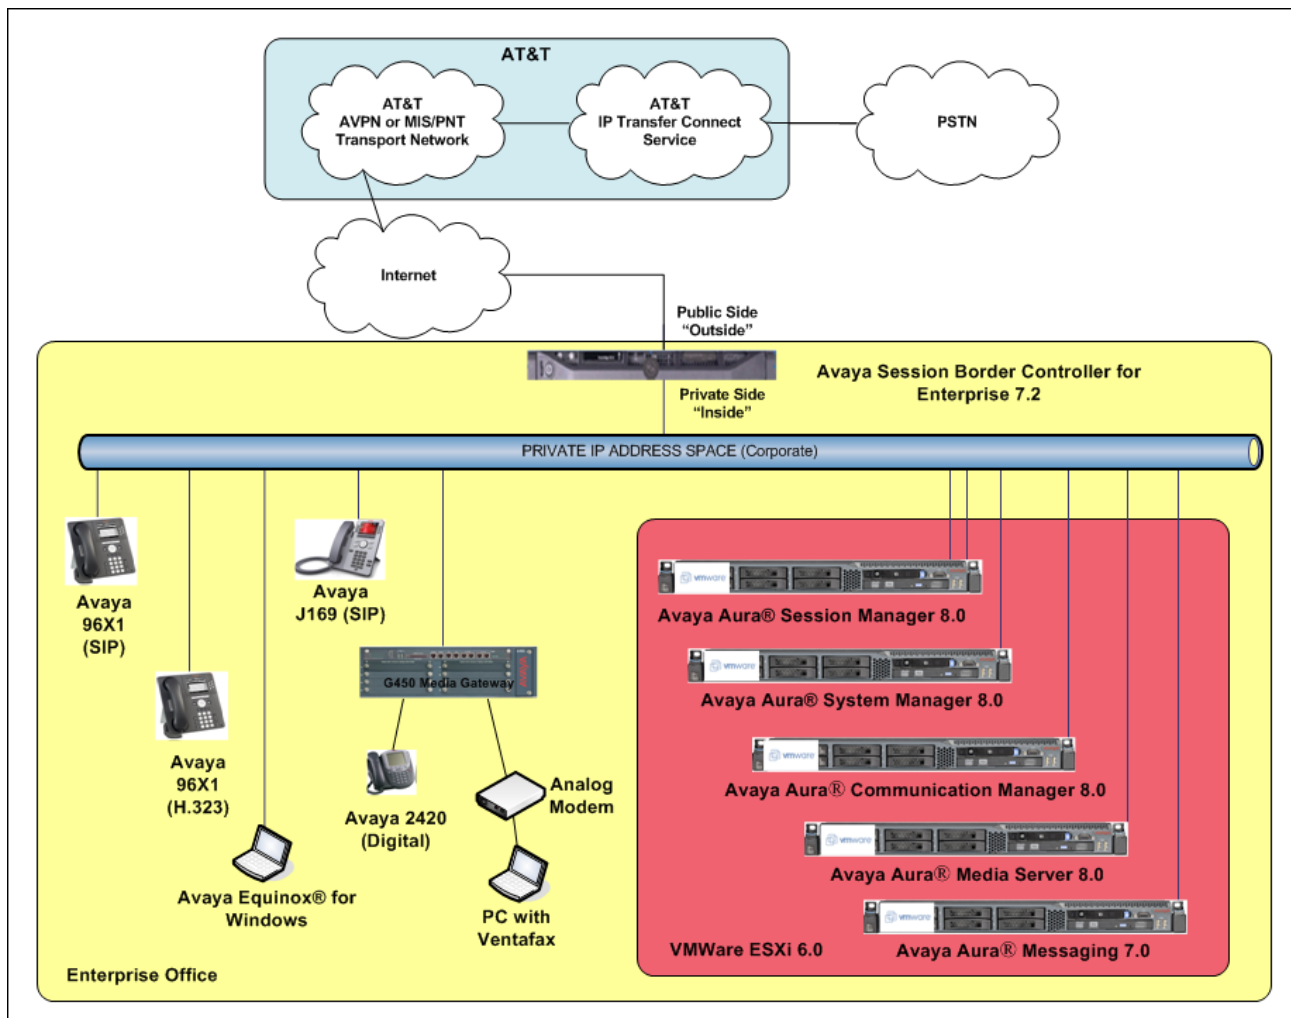

**Figure 1: Reference configuration**

### 3.1. Illustrative Configuration Information

The specific values listed in **Table 1** below and in subsequent sections are used in the reference configuration described in these Application Notes and are for illustrative purposes only. Customers must obtain and use the specific values for their own configurations.

**Note** – The IPTC service Border Element IP address and DID/DNIS digits are shown in this document as examples. AT&T Customer Care will provide the actual IP addresses and DID/DNIS digits as part of the IPTC provisioning process. In addition, the dialed IPTC DID numbers may not be the same as the DNIS numbers that IPTC delivers in the SIP Request URIs. *The provisioning in the following sections is based on the DNIS digits that IPTC delivers, **not** the dialed DID numbers.*

Component	Illustrative Value in these Application Notes
<b>Avaya Aura® Session Manager</b>	
Management IP Address	10.64.90.81
Network IP Address	10.64.91.81
<b>Avaya Aura® Communication Manager</b>	
IP Address	10.64.91.75
Avaya Aura® Communication Manager extensions	89xxx
<b>Avaya Aura® System Manager</b>	
IP Address	10.64.90.82
<b>Avaya Session Border Controller for Enterprise (SBCE)</b>	
IP Address of Inside (Private) Interface	10.64.91.41
IP Address of Outside (Public) Interface	192.168.80.43 (see note below)
<b>AT&amp;T IP Transfer Connect Border Element</b>	
IP Address	192.168.225.210 (see note below)

**Table 1: Illustrative Values Used in these Application Notes**

**Note** – The Avaya SBCE Outside interface communicates with AT&T Border Elements (BEs) located in the AT&T IP Transfer Connect network. For security reasons, the IP addresses of the AT&T BEs are not included in this document. However, as placeholders in the following configuration sections, the IP address of **192.168.80.43** (Avaya SBCE public interface), and **192.168.225.210** (AT&T BE IP address), are specified.




## 3.2. Call Flows

To understand how inbound IPTC service calls are handled by the Avaya SBCE, Session Manager, and Communication Manager, four general call flows are described in this section.

### 3.2.1. Basic Inbound Call

The first call scenario illustrated in **Figure 2** is an inbound IPTC service call that arrives at the Avaya SBCE. IP address, domain, and header manipulations are applied and then forwarded to Session Manager and is subsequently routed to Communication Manager, which in turn routes the call to a vector, agent, or phone. Note that no redirection is performed in this scenario.

1. A PSTN phone originates a call via the IPTC service.
2. The PSTN routes the call to the IPTC service network.
3. The IPTC service routes the call to the Avaya SBCE.
4. The Avaya SBCE performs SIP Network Address Translation (NAT) and any necessary SIP header modifications and routes the call to Session Manager.
5. Session Manager applies any necessary SIP header adaptations and digit conversions, and based on configured Network Routing Policies, determines where the call should be routed next. In this case, Session Manager routes the call to Communication Manager.
6. Depending on the called number, Communication Manager routes the call to (a) a vector, which in turn, routes the call to an agent or phone, or (b) directly to an agent or phone.

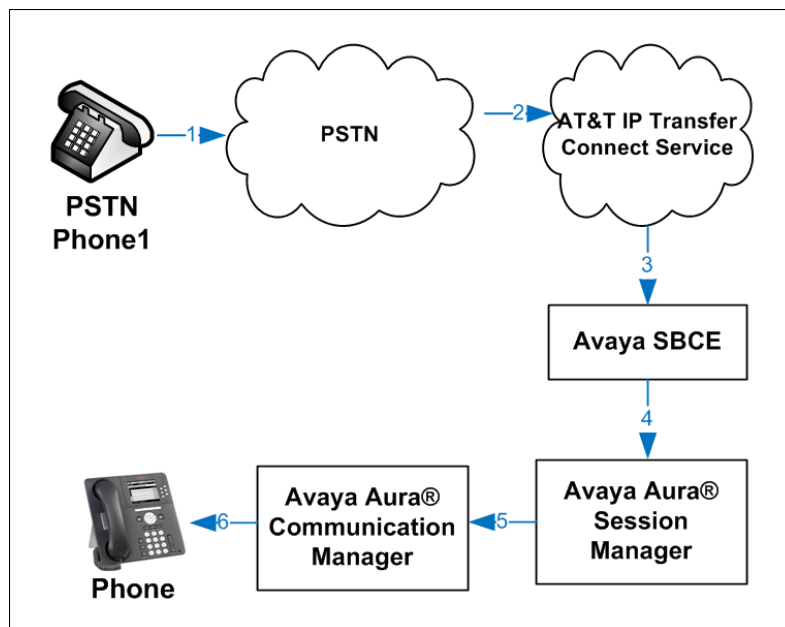


**Figure 2: Inbound IPTC Call – No Redirection**

### 3.2.2. 302 Call Redirection

**Note:** In the call scenarios that follow, the term “alternate destination” does NOT refer to the “Alternate Destination Routing (ADR)” service option of the AT&T IP Toll Free service. ADR and the IPTC service are unrelated.

The second call scenario illustrated in **Figure 3** is an inbound IPTC service call that arrives at the Avaya SBCE, is sent to Session Manager, and is subsequently routed to Communication Manager, which in turn routes the call to a vector. The vector immediately redirects the call back to the IPTC service for routing to an alternate destination.

1. Same as the first five steps from the first call scenario illustrated in **Figure 2**.
2. Communication Manager routes the call to a vector, which redirects the call by sending a SIP 302 message back out on the SIP trunk on which the inbound call arrived. The SIP 302 message is routed back through Session Manager and then the Avaya SBCE sends the call to the AT&T IP Transfer Connect service network. Since the SIP 302 message is a final response, the redirecting party (Communication Manager) is no longer involved in the call whether the redirection succeeds or fails, and thereby releases the trunk.
3. The IPTC service places a call to the alternate destination and upon answer, connects the calling party to the target party (alternate destination).

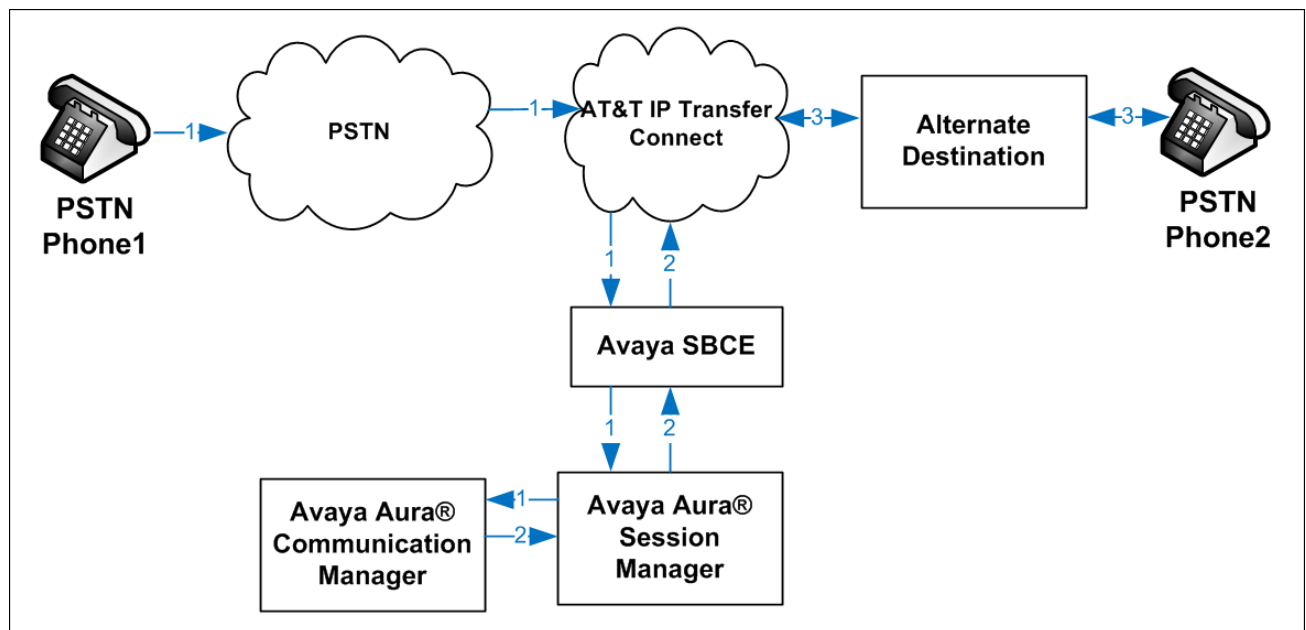


**Figure 3: Inbound IPTC Call –SIP 302 Redirection**

### 3.2.3. Refer Call Redirection

The third call scenario illustrated in **Figure 4** is an inbound IPTC service call that arrives on the Avaya SBCE, then is transferred to Session Manager and is subsequently routed to Communication Manager, which in turn routes the call to a vector. The vector answers the call and then redirects the call back to the IPTC service for routing to an alternate destination.

1. Same as the first five steps from the first call scenario illustrated in **Figure 2**.
2. Communication Manager routes the call to a vector, which answers the call and plays an announcement, and attempts to redirect the call by sending a SIP REFER message (without a *Replaces* header), back out on the SIP trunk on which the inbound call arrived. The SIP REFER message specifies the alternate destination and is routed back through Session Manager and then the Avaya SBCE sends the call to the IPTC service network.
3. The IPTC service places a call to the target party (alternate destination) and upon answer, connects the calling party to the target party.
4. The IPTC service clears the call on the redirecting/referring party (Communication Manager).

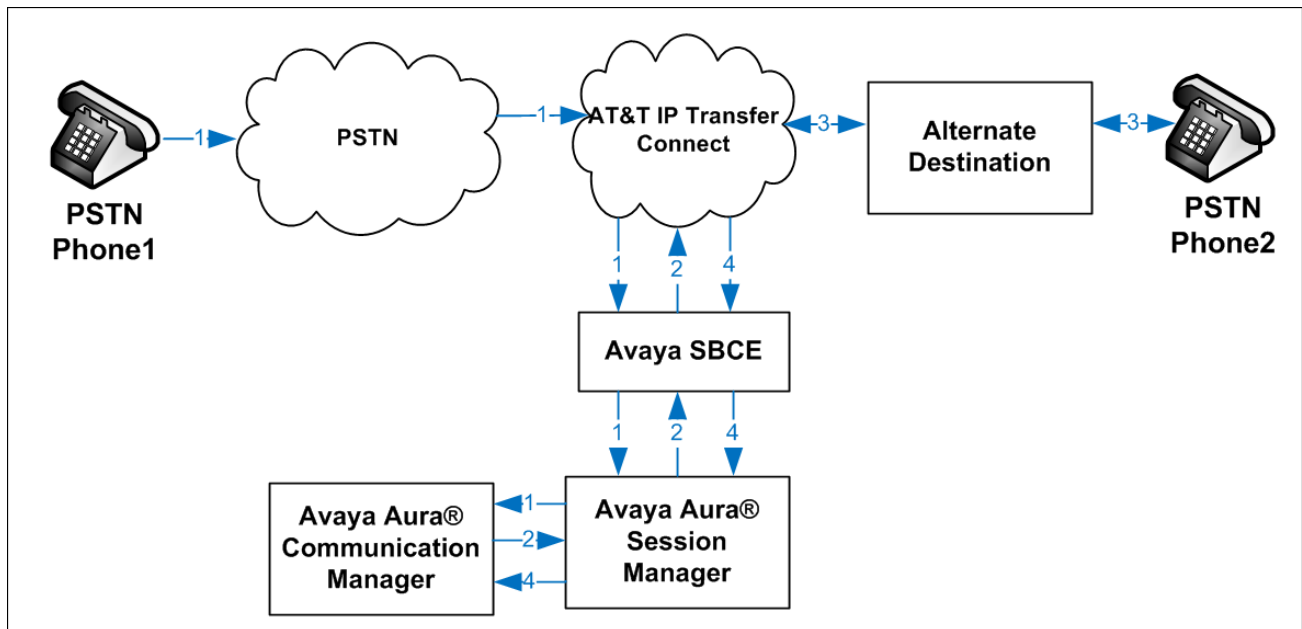


**Figure 4: Inbound IPTC Call –SIP REFER Redirection**

### 3.2.4. Refer Call Redirection – Error Handling

The fourth call scenario illustrated in **Figure 5** is similar to the fourth call scenario, except that the redirection is unsuccessful due to the alternate destination being busy or otherwise unavailable. As a result, Communication Manager “takes the call back” and routes the call to an agent/phone.

1. Same as the first five steps from the first call scenario illustrated in **Figure 2**.
2. Communication Manager routes the call to a vector, which answers the call and plays an announcement, and attempts to redirect the call by sending a SIP REFER message back out on the SIP trunk on which the inbound call arrived. The SIP REFER message specifies the alternate destination and is routed back through Session Manager and then the Avaya SBCE sends the call to the IPTC service network.
3. The IPTC service places a call to the target party (alternate destination), but the target party is busy or otherwise unavailable.
4. The IPTC service notifies the redirecting/referring party (Communication Manager) of the error condition.
5. Communication Manager routes the call to a local agent or phone.

**Note:** This “error handling” scenario occurs only with IPTC service lines enabled with the IPTC Attended IP Courtesy Transfer feature.

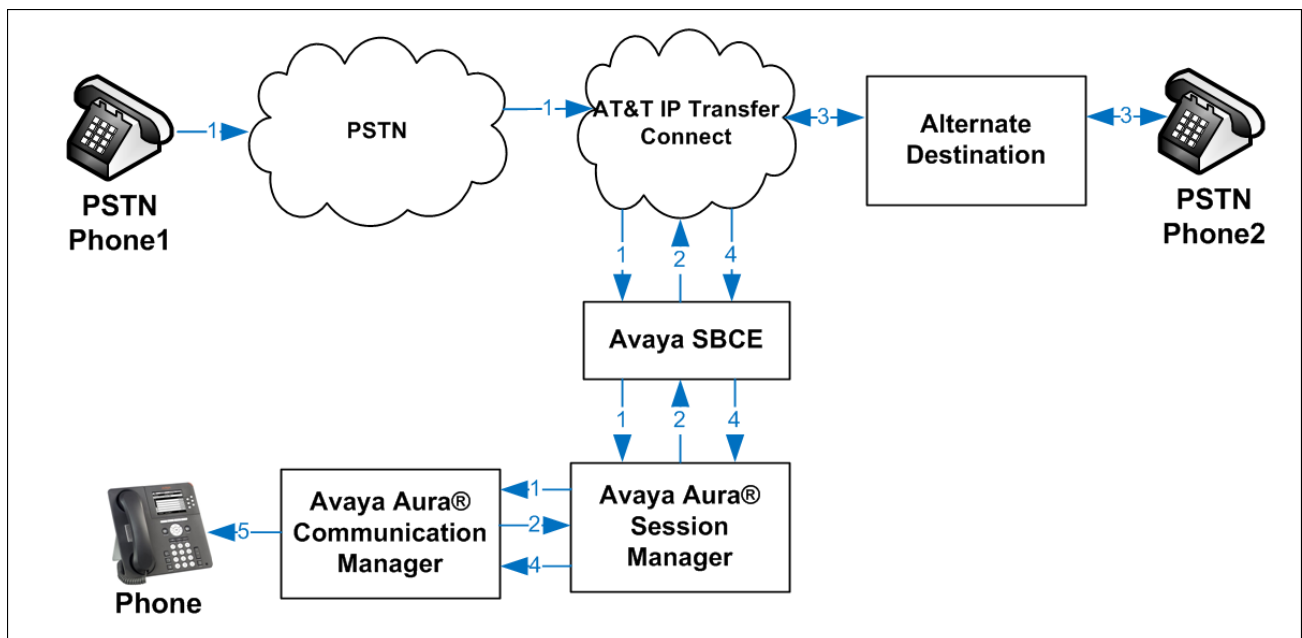

**Figure 5: Inbound IPTC Call - Unsuccessful SIP REFER Redirection/Reroute.**

## 4. Equipment and Software Validated

Equipment/Software	Release/Version
Avaya Aura® System Manager	• 8.0.0.0.931077
Avaya Aura® Session Manager	• 8.0.0.0.800035
Avaya Aura® Communication Manager	• 8.0.0.0-R018x.00.0.822.0
Avaya Aura® Media Server	• 8.0.0.6 • 8.0.0.117
Avaya Aura® Messaging	• 7.0-00.0.441.0-017_0004 (SP 0)
Avaya G450 Media Gateway	• 40.10.0
Avaya Session Border Controller for Enterprise	• 7.2.2.0-07-14883
Avaya 96x1 IP Telephones	• H.323 Version 6.6604 • SIP Version 7.1.3.0.11
Avaya J100 Series IP Telephone	• SIP Version 3.0.0.2.2

**Table 2: Equipment and Software Versions**

## 5. Avaya Aura® Session Manager

Session Manager administration for interaction with the AT&T IP Toll Free service is described in document [13] and is applicable for the IPTC service as well. This section describes the additional administration steps on Session Manager necessary for supporting interaction with the IPTC service.

### 5.1. Dial Patterns

Provision additional IPTC service DNIS numbers (digits delivered in the Request URIs of inbound IPTC INVITEs), so they can be converted to Communication Manager VDN, Agent, or station extensions. Follow the procedures described in **Section 5.8** of document [13].

## 6. Avaya Aura® Communication Manager

Communication Manager administration for interaction with the AT&T IP Toll Free service is described in document [13] and is applicable for the IPTC service as well. This section describes the additional administration steps on Communication Manager necessary for supporting interaction with the IPTC service. The steps shown below are performed using the Communication Manager System Access Terminal (SAT) interface.

**Note** – In the following sections, only the **highlighted** parameters are applicable to these Application Notes. Other parameters shown should be considered informational.

### 6.1. System Parameters

This section reviews additional Communication Manager licenses and features that are required for supporting the interaction with the IPTC service.

**Note - For any required features that cannot be enabled in the steps that follow, contact an authorized Avaya account representative to obtain the necessary licenses.**

1. Enter the **display system-parameters customer-options** command. On **Page 5** of the **system-parameters customer-options** form, verify that the **ISDN/SIP Network Call Redirection?** feature is set to “y”.

**display system-parameters customer-options**Page 5 of 12

OPTIONAL FEATURES

Emergency Access to Attendant? y	IP Stations? y
Enable 'dadmin' Login? y	
Enhanced Conferencing? y	ISDN Feature Plus? n
Enhanced EC500? y	<b>ISDN/SIP Network Call Redirection? y</b>
Enterprise Survivable Server? n	ISDN-BRI Trunks? y
Enterprise Wide Licensing? n	ISDN-PRI? y
ESS Administration? y	Local Survivable Processor? n
Extended Cvg/Fwd Admin? y	Malicious Call Trace? y
External Device Alarm Admin? y	Media Encryption Over IP? n
Five Port Networks Max Per MCC? n	Mode Code for Centralized Voice Mail? n
Flexible Billing? n	
Forced Entry of Account Codes? y	Multifrequency Signaling? y
Global Call Classification? y	Multimedia Call Handling (Basic)? y
Hospitality (Basic)? y	Multimedia Call Handling (Enhanced)? y
Hospitality (G3V3 Enhancements)? y	Multimedia IP SIP Trunking? y
IP Trunks? y	
IP Attendant Consoles? y	

(NOTE: You must logoff & login to effect the permission changes.)

2. On **Page 6** of the **system-parameters customer-options** form, verify that the **ACD**, **EAS**, and **Vectoring** features are set to “y”.

display system-parameters customer-options		Page 7 of 12
CALL CENTER OPTIONAL FEATURES		
Call Center Release: 7.0		
<b>ACD? y</b> BCMS (Basic)? y BCMS/VuStats Service Level? y BSR Local Treatment for IP & ISDN? y Business Advocate? n Call Work Codes? y DTMF Feedback Signals For VRU? y Dynamic Advocate? n <b>Expert Agent Selection (EAS)? y</b> EAS-PHD? y Forced ACD Calls? n Least Occupied Agent? y Lookahead Interflow (LAI)? y Multiple Call Handling (On Request)? y Multiple Call Handling (Forced)? y PASTE (Display PBX Data on Phone)? y (NOTE: You must logoff & login to effect the permission changes.)	Reason Codes? y Service Level Maximizer? n Service Observing (Basic)? y Service Observing (Remote/By FAC)? y Service Observing (VDNs)? y Timed ACW? y <b>Vectoring (Basic)? y</b> <b>Vectoring (Prompting)? y</b> <b>Vectoring (G3V4 Enhanced)? y</b> <b>Vectoring (3.0 Enhanced)? y</b> <b>Vectoring (ANI/II-Digits Routing)? y</b> <b>Vectoring (G3V4 Advanced Routing)? y</b> <b>Vectoring (CINFO)? y</b> <b>Vectoring (Best Service Routing)? y</b> <b>Vectoring (Holidays)? y</b> <b>Vectoring (Variables)? y</b>	



## 6.2. Trunks

This section describes the steps for modifying the SIP trunk to Session Manager to support the interaction with the IPTC service.

1. Enter the **change trunk-group x** command, where **x** is the number of the trunk group administered in document [13] for inbound AT&T IP Toll Free service calls (e.g., trunk 4). On **Page 4** of the **trunk-group** form, set **Network Call Redirection** to **y**.

<b>change trunk-group 4</b>	<b>Page 4 of 21</b>
PROTOCOL VARIATIONS	
Mark Users as Phone? n	
Prepend '+' to Calling/Alerting/Diverting/Connected Number? n	
Send Transferring Party Information? n	
<b>Network Call Redirection? y</b>	
Build Refer-To URI of REFER From Contact For NCR? n	
Send Diversion Header? n	
Support Request History? y	
Telephone Event Payload Type: 100	
Shuffling with SDP? n	
Convert 180 to 183 for Early Media? n	
Always Use re-INVITE for Display Updates? n	
Identity for Calling Party Display: P-Asserted-Identity	
Block Sending Calling Party Location in INVITE? n	
Accept Redirect to Blank User Destination? n	
Enable Q-SIP? n	
Interworking of ISDN Clearing with In-Band Tones: keep-channel-active	
Request URI Contents: may-have-extra-digits	

## 6.3. Inbound Call Routing

This section describes the steps for routing inbound IPTC service calls to reach Vector Directory Numbers (VDNs) with corresponding programmable vectors. These vectors contain steps that were used to invoke Communication Managers SIP Network Call Redirection (NCR) functionality.

Two different inbound call routing scenarios are described in these Application Notes:

- Pre-Answer Redirection - An inbound IPTC service call that invokes SIP NCR (using a SIP 302 message) prior to the call being answered.
- Post-Answer Redirection - An inbound IPTC service call that invokes SIP NCR (using a SIP REFER message) after the call has been answered by a vector and an announcement is played to the caller.

**Note** - These Application Notes provide rudimentary vector definitions to demonstrate and test the Communication Manager NCR and UII functionalities. More complex vector functionality would be used by call centers that is tailored to their individual needs. Alternatively, call centers could use dedicated Interactive Voice Response (IVR) applications to trigger embedded, and/or Communication Manager, call redirection functionality. The definition and documentation of those IVR applications, or associated vector programming, are beyond the scope of these Application Notes.

### 6.3.1. Pre-Answer Redirection - 302

This section provides an example of Pre-Answer Redirection. In this example, the inbound call is routed to the VDN shown in **Figure 7**, which invokes the vector shown in **Figure 8**. Note that the vector does not specify ring back (see **Section 2.2, item 1**). The vector does the following:

1. Assigns the data “**1234567890123456**” to ASAI UII variable “**A**” (vector step **02**).  
**Note:** The parameters for ASAI UII variables “**A**” and “**B**”, and other vector variables are defined using the **change variables** command (see **Figure 6**).
2. Redirects the call to the number “**11041**” (vector step **04**). Note that since this vector did not answer the call, the presence of the “**~r**” in the “**route-to number**” line instructs Communication Manager to send a SIP 302 message with the number “**11041**” in the user part of the Contact header URI, (e.g., 11041@<IP/domain>), to the IPTC service (via Session Manager and the Avaya SBCE).

change variables		VARIABLES FOR VECTORS					Page 1 of 39
Var	Description	Type	Scope	Length	Start	Assignment	VAC
A	uui	asaiuui	L	16	1		
B	uui	asaiuui	L	10	17		
C	ani	ani	L	16	1		

**Figure 6: Change Variables Form**

```

display vdn 71043                                     Page 1 of 3
                                                    VECTOR DIRECTORY NUMBER

      Extension: 71043
      Name*: 302 Redirect
      Destination: Vector Number 3
Attendant Vectoring? n
Meet-me Conferencing? n
Allow VDN Override? n
COR: 1
TN*: 1
Measured: none

VDN of Origin Annc. Extension*:
1st Skill*:
2nd Skill*:
3rd Skill*:

```

**Figure 7: Sample VDN for Pre-Answer Redirection**

```

display vector 3                                       Page 1 of 6
                                                    CALL VECTOR

      Number: 3                                     Name: 302 moved
Multimedia? n      Attendant Vectoring? n      Meet-me Conf? n      Lock? n
Basic? y      EAS? y      G3V4 Enhanced? y      ANI/II-Digits? y      ASAI Routing? y
Prompting? y      LAI? y      G3V4 Adv Route? y      CINFO? y      BSR? y      Holidays? y
Variables? y      3.0 Enhanced? y
01 #      Sets UII to ANI of caller
02 set      A      = none      CATTR 1234567890123456
03 #      Redirect to Speed Dial Number 11041
04 route-to      number ~r11041      with cov n if unconditionally
05 stop

```

**Figure 8: Sample Vector for Pre-Answer Redirection (302)**

### 6.3.2. Post-Answer Redirection - Refer

This section provides an example of Post-Answer Redirection. In this example, the inbound call is routed to the VDN shown in **Figure 9**, which invokes the vector shown in **Figure 10**. The vector does the following:

1. Assigns the data “1234567890123456” to ASAI UII variable “A” (vector steps **02**).  
**Note:** The parameters for UII variable “A” and other vector variables are defined using the **change variables** command (see **Figure 6**).
2. Answers the call to play an announcement (vector step **05**).
3. Attempts to redirect the call to the number “11041” (vector step **08**). Note that since this vector answered the call, the presence of the “~r” in the “**route-to number**” line instructs Communication Manager to send a SIP REFER message with the number “11041” in the user part of the Refer-To header URI, (e.g., 1092@<IP/domain>) to the IPTC service (via Session Manager and the Avaya SBCE).

```

display vdn 71044                                     Page 1 of 3
                                VECTOR DIRECTORY NUMBER

                                Extension: 71044
                                Name*: REFER
                                Destination: Vector Number      8
                                Attendant Vectoring? n
                                Meet-me Conferencing? n
                                Allow VDN Override? n
                                COR: 1
                                TN*: 1
                                Measured: none

                                VDN of Origin Annc. Extension*:
                                1st Skill*:
                                2nd Skill*:
                                3rd Skill*:

* Follows VDN Override Rules

```

**Figure 9: Sample VDN for Post-Answer Redirection**

```

display vector 8                                     Page 1 of 6
                                CALL VECTOR

                                Number: 8                    Name: REFER w/UII
Multimedia? n      Attendant Vectoring? n      Meet-me Conf? n      Lock? n
  Basic? y      EAS? y      G3V4 Enhanced? y      ANI/II-Digits? y      ASAI Routing? y
  Prompting? y      LAI? y      G3V4 Adv Route? y      CINFO? y      BSR? y      Holidays? y
  Variables? y      3.0 Enhanced? y
01 #      Create UII
02 set          A          = none      CATR 1234567890123456
03
04 #      Play Refer announcement
05 announcement 11006
06
07 #      Refer occurs since this is post answer
08 route-to      number ~r11041      with cov n if unconditionally
09 #      If Refer fails play announcement and disconnect
10 disconnect      after announcement 11003
11

```

**Figure 10: Sample Vector for Post-Answer Redirection (Refer)**

## **7. Avaya Session Border Controller for Enterprise**

Avaya SBCE configuration for interaction with the AT&T IP Toll Free service provided in document [13] should also be followed for interoperability with the IPTC service.

## **8. Verification Steps**

### **8.1. Call Verification**

The call verification steps and troubleshooting tools described for the AT&T Toll Free service described in document [13], also apply to the IPTC service. In addition:

1. Place an inbound call to an IPTC service line enabled with Redirect features. Verify that an appropriate Communication Manager vector immediately redirects the call back to the IPTC service for delivery to an alternate destination using 302. Verify two-way talk path and transmission of UII information as appropriate.
2. Place an inbound call to an IPTC service number enabled with Refer features. Verify that an appropriate Communication Manager vector answers the call and then redirects the call back to the IPTC service for delivery to an alternate destination using Refer. Verify two-way talk path and transmission of UII information as appropriate.


## 8.2. Protocol Traces

Use a SIP protocol analyzer (e.g., Wireshark), to monitor the SIP traffic at the locations specified below.

### 8.2.1. 302 Redirection

Monitor the SIP traffic at the Avaya SBCE public “outside” interface connection to the IPTC service. Below is an example of a 302-redirection call filtering on the SIP protocol. Note the following:

- The Contact header contains the new called number (11041) as defined in vector 3 (see **Section 6.3.1**).
- The User-to-User Information (UII) defined in vector 3.
- 180 Ringing is not sent prior to the 302 (see **Sections 2.2, Item 1** and **Section 6.3.1**).

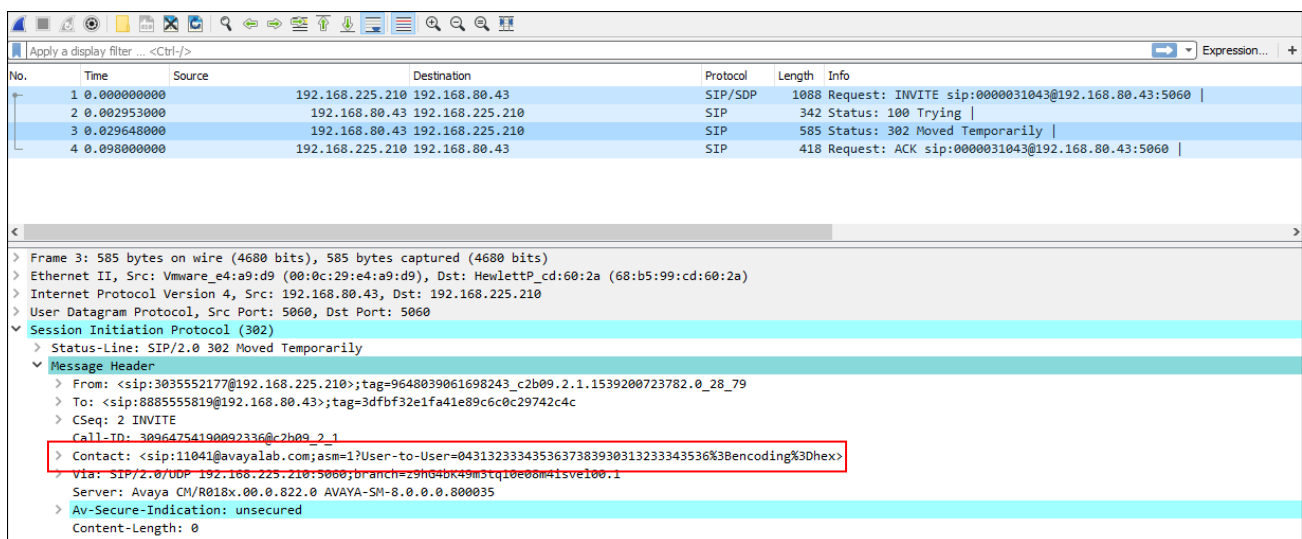

No.	Time	Source	Destination	Protocol	Length	Info
1	0.000000000		192.168.225.210 192.168.80.43	SIP/SDP	1088	Request: INVITE sip:0000031043@192.168.80.43:5060
2	0.002953000		192.168.80.43 192.168.225.210	SIP	342	Status: 100 Trying
3	0.029648000		192.168.80.43 192.168.225.210	SIP	585	Status: 302 Moved Temporarily
4	0.098000000		192.168.225.210 192.168.80.43	SIP	418	Request: ACK sip:0000031043@192.168.80.43:5060

Frame 3: 585 bytes on wire (4680 bits), 585 bytes captured (4680 bits)
> Ethernet II, Src: Vmware_e4:a9:d9 (00:0c:29:e4:a9:d9), Dst: HewlettP_cd:60:2a (68:b5:99:cd:60:2a)
> Internet Protocol Version 4, Src: 192.168.80.43, Dst: 192.168.225.210
> User Datagram Protocol, Src Port: 5060, Dst Port: 5060
> Session Initiation Protocol (302)
> Status-Line: SIP/2.0 302 Moved Temporarily
> Message Header
> From: <sip:3035552177@192.168.225.210>;tag=9648039061698243_c2b09.2.1.1539200723782.0_28_79
> To: <sip:8885555819@192.168.80.43>;tag=3dfbf32e1fa41e89c6c0c29742c4c
> CSeq: 2 INVITE
> Call-ID: 30964754190092336@c2b09.2.1
> Contact: <sip:11041@avaya1ab.com;asm=1?User-to-User=0431323334353637383930313233343536%3Bencoding%3Dhex>
> Via: SIP/2.0/UDP 192.168.225.210:5060;branch=z9hG4kQ9mStq10e08m41sve100.1
> Server: Avaya CM/R018x.00.0.822.0 AVAYA-SM-8.0.0.0.800035
> Av-Secure-Indication: unsecured
> Content-Length: 0

## 8.2.2. Refer

The following is an example of a Refer redirection call filtering on the SIP protocol. Note the following:

- Communication Manager is sending 180 Ringing in frame 3 (see the comment in **Section 8.2.1**, above).
- The Refer-To header (shown at the bottom of the screen shot) specifies the new called number (11041) as defined in vector 8 (see **Section 6.3.2**). Also note the UII information also defined on vector 8.
- In frame 22 Communication Manager terminates the initial call leg.

No.	Time	Source	Destination	Protocol	Length	Info
1	0.000000000	192.168.225.210	192.168.80.43	SIP/SDP	1089	Request: INVITE sip:0000031043@192.168.80.43:5060
2	0.002780000	192.168.80.43	192.168.225.210	SIP	342	Status: 100 Trying
3	0.012545000	192.168.80.43	192.168.225.210	SIP	692	Status: 180 Ringing
4	2.028284000	192.168.80.43	192.168.225.210	SIP	692	Status: 180 Ringing
5	2.044618000	192.168.80.43	192.168.225.210	SIP/SDP	961	Status: 200 OK
6	2.239928000	192.168.225.210	192.168.80.43	SIP	414	Request: ACK sip:192.168.80.43:5060;asm=1
7	3.003976000	192.168.80.43	192.168.225.210	SIP	524	Request: OPTIONS sip:att.com:5060[Malformed Packet]
8	3.839085000	192.168.80.43	192.168.225.210	SIP	873	Request: REFER sip:192.168.225.210:5060;asm=1, in-dialog
9	3.671865000	192.168.225.210	192.168.80.43	SIP	446	Status: 405 Method Not Allowed
10	3.919393000	192.168.225.210	192.168.80.43	SIP	509	Status: 202 ACCEPTED
11	3.927234000	192.168.225.210	192.168.80.43	SIP/sip...	594	Request: NOTIFY sip:192.168.80.43:5060;asm=1   , with Sipfrag(SIP/2.0 100 Trying)
12	3.931401000	192.168.225.210	192.168.80.43	SIP/SDP	822	Request: INVITE sip:192.168.80.43:5060;asm=1, in-dialog
13	3.952110000	192.168.80.43	192.168.225.210	SIP	377	Status: 100 Trying
14	3.958220000	192.168.80.43	192.168.225.210	SIP	562	Status: 200 OK
15	3.960474000	192.168.80.43	192.168.225.210	SIP	478	Status: 491 Request Pending
16	4.028737000	192.168.225.210	192.168.80.43	SIP	414	Request: ACK sip:192.168.80.43:5060;asm=1
17	4.065092000	192.168.225.210	192.168.80.43	SIP/SDP	790	Request: INVITE sip:0000011041@192.168.80.43:5060
18	4.068240000	192.168.80.43	192.168.225.210	SIP	340	Status: 100 Trying
19	4.116495000	192.168.80.43	192.168.225.210	SIP	727	Status: 180 Ringing
20	4.199085000	192.168.225.210	192.168.80.43	SIP/sip...	595	Request: NOTIFY sip:192.168.80.43:5060;asm=1   , with Sipfrag(SIP/2.0 180 Ringing)
21	4.204831000	192.168.80.43	192.168.225.210	SIP	562	Status: 200 OK
22	4.206449000	192.168.80.43	192.168.225.210	SIP	603	Request: BYE sip:192.168.225.210:5060;asm=1
23	4.281471000	192.168.225.210	192.168.80.43	SIP	450	Status: 200 OK

> Frame 8: 873 bytes on wire (6984 bits), 873 bytes captured (6984 bits)

> Ethernet II, Src: Vmware\_e4:a9:d9 (00:0c:29:e4:a9:d9), Dst: HewlettP\_cd:60:2a (68:b5:99:cd:60:2a)

> Internet Protocol Version 4, Src: 192.168.80.43, Dst: 192.168.225.210

> User Datagram Protocol, Src Port: 5060, Dst Port: 5060

> Session Initiation Protocol (REFER)

> Request-Line: REFER sip:192.168.225.210:5060;asm=1 SIP/2.0

> Message Header

> From: <8885555819@192.168.80.43>;tag=f22180c2e21341e8b5f40c29742c4c

> To: <3035552177@192.168.225.210>;tag=14271400731517858\_c2b09.2.4.1539200867957\_0\_21\_70

> CSeq: 1 REFER

> Call-ID: 7793061843005261@c2b09\_2\_4

> Contact: "732-555-4052" <192.168.80.43:5060;asm=1>

> Record-Route: <192.168.80.43:5060;ipcs-line=1409643;l;transport=udp>

> Allow: INVITE, ACK, OPTIONS, BYE, CANCEL, SUBSCRIBE, NOTIFY, REFER, INFO, PRACK, PUBLISH, UPDATE

> Supported: histinfo, join, replaces, timer

> User-Agent: Avaya CM/R018x.00.0.822.0 AVAYA-SM-8.0.0.0.800035

> Max-Forwards: 66

> Via: SIP/2.0/UDP 192.168.80.43:5060;branch=9b64bK-c1632-001711021022-1-c1632

> Refer-To: <11041@192.168.225.210:5060>

> P-Asserted-Identity: "732-555-4052" <8885555819@192.168.80.43>

> Content-Length: 0

## 9. Conclusion

As illustrated in these Application Notes, Avaya Aura® Session Manager 8.0, Avaya Aura® Communication Manager 8.0, and the Avaya Session Border Controller for Enterprise 7.2 can be configured to interoperate successfully with the AT&T IP Transfer Connect service.

In addition, these Application Notes further demonstrate that the Avaya Aura® Communication Manager SIP Network Call Redirection (NCR) and User-to-User Information (UII) features can work in complement with the AT&T implementations of SIP NCR and UII to support call redirection over SIP trunks while preserving initiating caller information. The transmission of Multipart headers was also confirmed.

This solution provides contact center users of Avaya Aura® Communication Manager the ability to redirect inbound AT&T IP Transfer Connect service calls to alternate destinations (using Refer and 302 redirection), and deliver UII-encoded customer information to those alternate destinations for the purposes of invoking contact center applications, e.g., triggering agent screen pop-ups with caller information, etc. Both intra-site and IP Transfer Connect call scenarios were tested.

The sample configuration shown in these Application Notes is representative of a basic enterprise customer configuration and is intended to provide configuration guidance to supplement other Avaya product documentation. It is based upon formal interoperability compliance testing as part of the Avaya DevConnect Service Provider program.



## 10. References

### **Avaya Aura® Session Manager/System Manager**

- [1] Deploying Avaya Aura® Session Manager, Release 8.0, Issue 4, December 2017
- [2] Administering Avaya Aura® Session Manager, Release 8.0, Issue 4, March 2018
- [3] Deploying Avaya Aura® System Manager, Release 8.0, Issue 6, March 2018
- [4] Administering Avaya Aura® System Manager for Release 8.0, Issue 11, March 2018

### **Avaya Aura® Communication Manager**

- [5] Deploying Avaya Aura® Communication Manager, Release 8.0, Issue 3, December 2017
- [6] Administering Avaya Aura® Communication Manager, Release 8.0, Issue 5, February 2018
- [7] Administering Avaya G450 Branch Gateway, Release 8.0, Issue 2, December 2017
- [8] Deploying and Updating Avaya Aura® Media Server Appliance, Release 7.8, Issue 4, December 2017
- [9] Quick Start Guide to Using the Avaya Aura® Media Server with Avaya Aura® Communication Manager, August 2015
- [10] Programming Call Vectors in Avaya Aura® Call Center, 6.0, June 2010

### **Avaya Session Border Controller for Enterprise**

- [11] Administering Avaya Session Border Controller for Enterprise, Release 7.2.2, Issue 9, April 2018
- [12] Deploying Avaya Session Border Controller for Enterprise, Release 7.2.2, Issue 7, April 2018

### **Avaya Application Notes**

- [13] *Application Notes for Avaya Aura® Communication Manager 8.0, Avaya Aura® Session Manager 8.0 and Avaya Session Border Controller for Enterprise 7.2 with AT&T IP Toll Free SIP Trunk Service – Issue 1.0*

**AT&T IP Transfer Connect Service:**

The AT&T Transfer Connect service is part of the AT&T IP Toll Free offer.

- AT&T IP Toll Free Service description -  
[http://www.corp.att.com/gov/solution/network\\_services/voice\\_services/tollfreeserv.html](http://www.corp.att.com/gov/solution/network_services/voice_services/tollfreeserv.html)

**©2019 Avaya Inc. All Rights Reserved.**

Avaya and the Avaya Logo are trademarks of Avaya Inc. All trademarks identified by <sup>TM</sup> and <sup>®</sup> are registered trademarks or trademarks, respectively, of Avaya Inc. All other trademarks are the property of their respective owners. The information provided in these Application Notes is subject to change without notice. The configurations, technical data, and recommendations provided in these Application Notes are believed to be accurate and dependable, but are presented without express or implied warranty. Users are responsible for their application of any products specified in these Application Notes.

Please e-mail any questions or comments pertaining to these Application Notes along with the full title name and filename, located in the lower right corner, directly to the Avaya DevConnect program at [devconnect@avaya.com](mailto:devconnect@avaya.com).