



Application Notes for Plantronics Savi W710 DECT/USB Headset and Plantronics Hub Software with Avaya Communicator for Windows - Issue 1.0

Abstract

These Application Notes describe a compliance-tested configuration comprised of Plantronics Savi W710 DECT/USB Headset and Plantronics Hub software with Avaya Communicator for Windows. Designed for those who spend hours each day on long conference calls, webinars and video conferencing, the Savi W710 Headset makes communications more effective and productive.

Readers should pay attention to **Section 2**, in particular the scope of testing as outlined in **Section 2.1** as well as the observations noted in **Section 2.2**, to ensure that their own use cases are adequately covered by this scope and results.

Information in these Application Notes has been obtained through DevConnect compliance testing and additional technical discussions. Testing was conducted via the DevConnect Program at the Avaya Solution and Interoperability Test Lab.

1. Introduction

These Application Notes describe the configuration steps required for Plantronics Savi W710 DECT/USB Headset and Plantronics Hub software with Avaya Communicator for Windows. Designed for those who spend hours each day on long conference calls, webinars and video conferencing, the Savi W710 Headset makes communications more effective and productive. The Savi W710 Headset employs simple plug-and-play USB connectivity to the PC.

2. General Test Approach and Test Results

The interoperability compliance test included feature and serviceability testing. The feature testing focused on placing calls to and from Avaya Communicator for Windows using Plantronics Savi W710 Headset and verifying good talk path in both directions. The type of calls made included calls to voicemail, to internal extensions and to the PSTN.

The serviceability testing focused on verifying the usability of Plantronics Savi W710 Headset after restarting the Avaya Communicator for Windows, disconnecting and reconnecting the Headsets and rebooting the PC.

DevConnect Compliance Testing is conducted jointly by Avaya and DevConnect members. The jointly-defined test plan focuses on exercising APIs and/or standards-based interfaces pertinent to the interoperability of the tested products and their functionalities. DevConnect Compliance Testing is not intended to substitute full product performance or feature testing performed by DevConnect members, nor is it to be construed as an endorsement by Avaya of the suitability or completeness of a DevConnect member's solution

Avaya's formal testing and Declaration of Conformity is provided only on the headsets/handsets that carry the Avaya brand or logo. Avaya may conduct testing of non-Avaya headset/handset to determine interoperability with Avaya phones. However, Avaya does not conduct the testing of non-Avaya headsets/handsets for: Acoustic Pressure, Safety, Hearing Aid Compliance, EMC regulations, or any other tests to ensure conformity with safety, audio quality, long-term reliability or any regulation requirements. As a result, Avaya makes no representations whether a particular non-Avaya headset will work with Avaya's telephones or with a different generation of the same Avaya telephone.

Since there is no industry standard for handset interfaces, different manufacturers utilize different handset/headset interfaces with their telephones. Therefore, any claim made by a headset vendor that its product is compatible with Avaya telephones does not equate to a guarantee that the headset will provide adequate safety protection or audio quality.

2.1. Interoperability Compliance Testing

All test cases were performed manually. The following features were verified:

- Placing calls to the voicemail system. Voice messages were recorded and played back to verify that the playback volume and recording level were good.
- Placing calls to internal extensions to verify two-way audio.
- Placing calls to the PSTN to verify two-way audio.
- Incoming call alert notification.
- Hearing ring back tone for outgoing calls.
- Using the mute control button on Avaya Communicator for Windows and the headsets to mute and un-mute the audio.
- Using the hold feature from the Avaya Communicator for Windows.
- Initiating and terminating calls from the base station of the headset.

The serviceability testing focused on verifying the usability of Plantronics Savi W710 Headset after restarting the Avaya Communicator for Windows, disconnecting and reconnecting the Headsets and rebooting the PC.

2.2. Test Results

All executed test cases passed.

2.3. Support

For technical support and information on Plantronics headsets, contact Plantronics at:

- Phone: 1-855-765-7878
1-831-426-5858 (International)
- Website: <http://www.plantronics.com/us/support/index.jsp>

3. Reference Configuration

Figure 1 illustrates the test configuration used to verify the Plantronics solution. The configuration comprised of an Avaya Aura® Communication Manager (Communication Manager), Avaya Aura® Session Manager (Session Manager), Avaya Aura® System Manager and an Avaya G650 Media Gateway. The H.323 based stations are registered to the Communication Manager and the SIP based stations are registered to the Session Manager. The Plantronics Hub software and Avaya Communicator for Windows were installed on the same PC. The Plantronics W710 USB Headset was connected to this PC via the USB port.

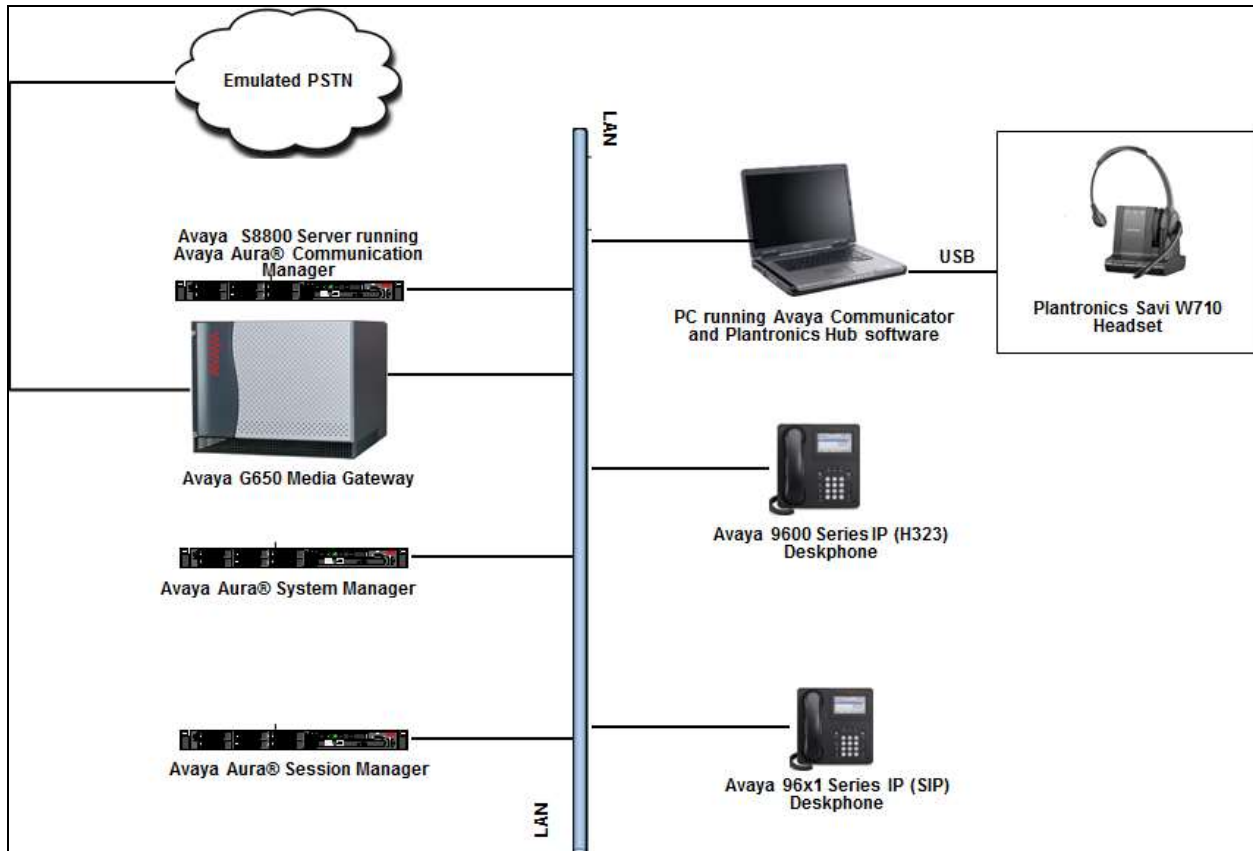


Figure 1: Test Configuration

4. Equipment and Software Validated

The following equipment and software were used for the sample configuration provided:


Equipment/Software	Release/Version
Avaya Aura® System Manager running on an Avaya S8800 Server	6.3.14
Avaya Aura® Communication Manager running on an Avaya S8800 Server	6.3.12.0-SP12 (R016x.03.0.124.0-22505)R016x.03.0.124.0
Avaya Aura® Session Manager running on an Avaya S8800 Server	6.3.14.0.631402
Avaya Communicator for Windows	2.1.2.75
Avaya IP Deskphones: <ul style="list-style-type: none">• 9608 (H.323)• 96x1 (SIP)	6.4014 6.3.14
Plantronics Hub Software	3. 6.51102.21715
Plantronics W710 Headset	Base: v.28.47 Bluetooth: v.02.05.0d, 0e Headset: v.28.25 PIC: v.2.2 Tuning: v. USB: v.179
Windows OS	Windows 7 Professional SP1

5. Configure Avaya Aura® Communication Manager


It is assumed that a fully functioning Avaya Aura® Communication Manager is in place with the necessary licensing and that an extension is configured to handle softphone and Avaya one-X® Communicator. For further information on the configuration of Avaya Aura® Communication Manager please see **Section 10** of these Application Notes.

6. Configure Avaya Communicator for Windows

After logging into Avaya Communicator for Windows, select  → **Other Settings** from the menu as shown below.

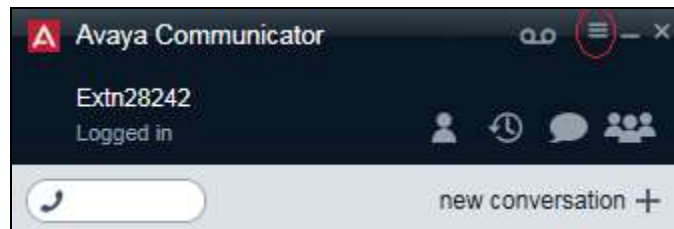

From the **Audio** tab ensure that the **Microphone** and **Speaker** options are selected for Plantronics headset. In the screenshot below Plantronics Savi 7xx is selected.

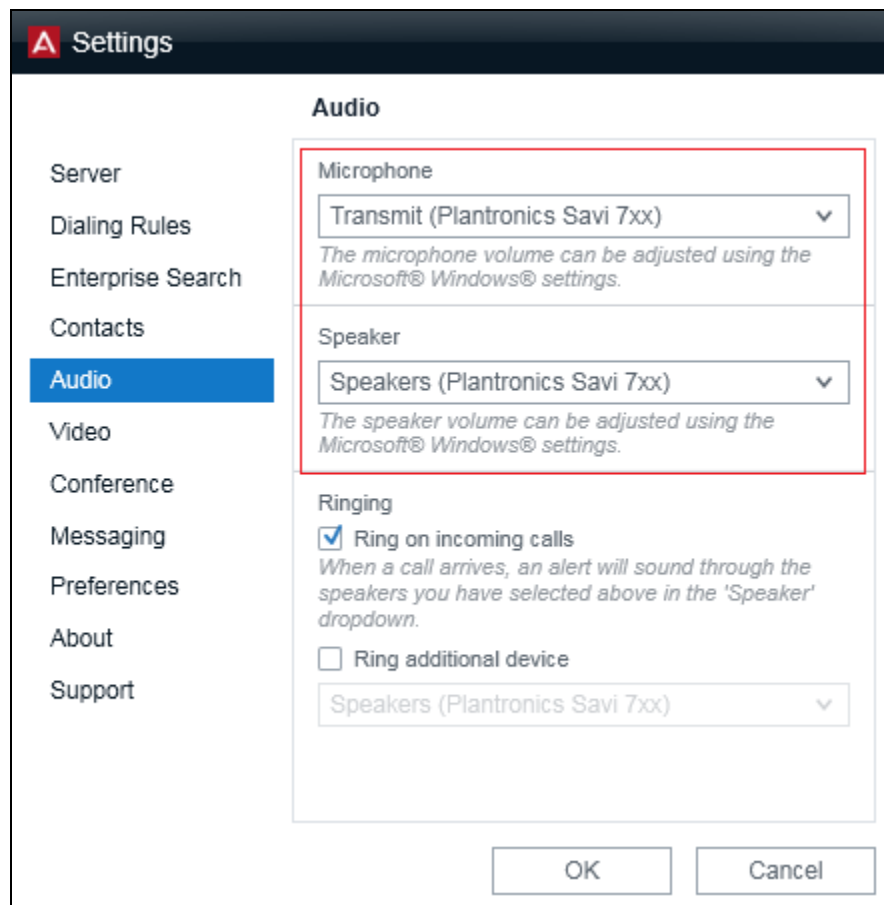

7. Configure Plantronics Savi W710 Headset


The Plantronics Savi W710 Headset is a USB plug-and-play device. When plugged into the USB Port of a PC, it is automatically detected in Microsoft Windows without requiring any additional driver software. In this test configuration, the Plantronics Savi W710 Headset is detected as **Plantronics W710** in Windows 7.

7.1. Install Plantronics Hub Software

The Plantronics Hub software can be downloaded from the Plantronics web page. Some of the software enabled functionality of the Hub are:


- Call control across multiple softphones.
- Battery meter conveniently displays headset battery life remaining in PC icon tray.
- Headset control panel allows for customization of settings, including call notification and related options.

After the Hub software is installed, navigate to **Settings** → **Softphones** and under **Software Settings** select *Avaya Communicator* from the drop down menu. Click **Apply**.

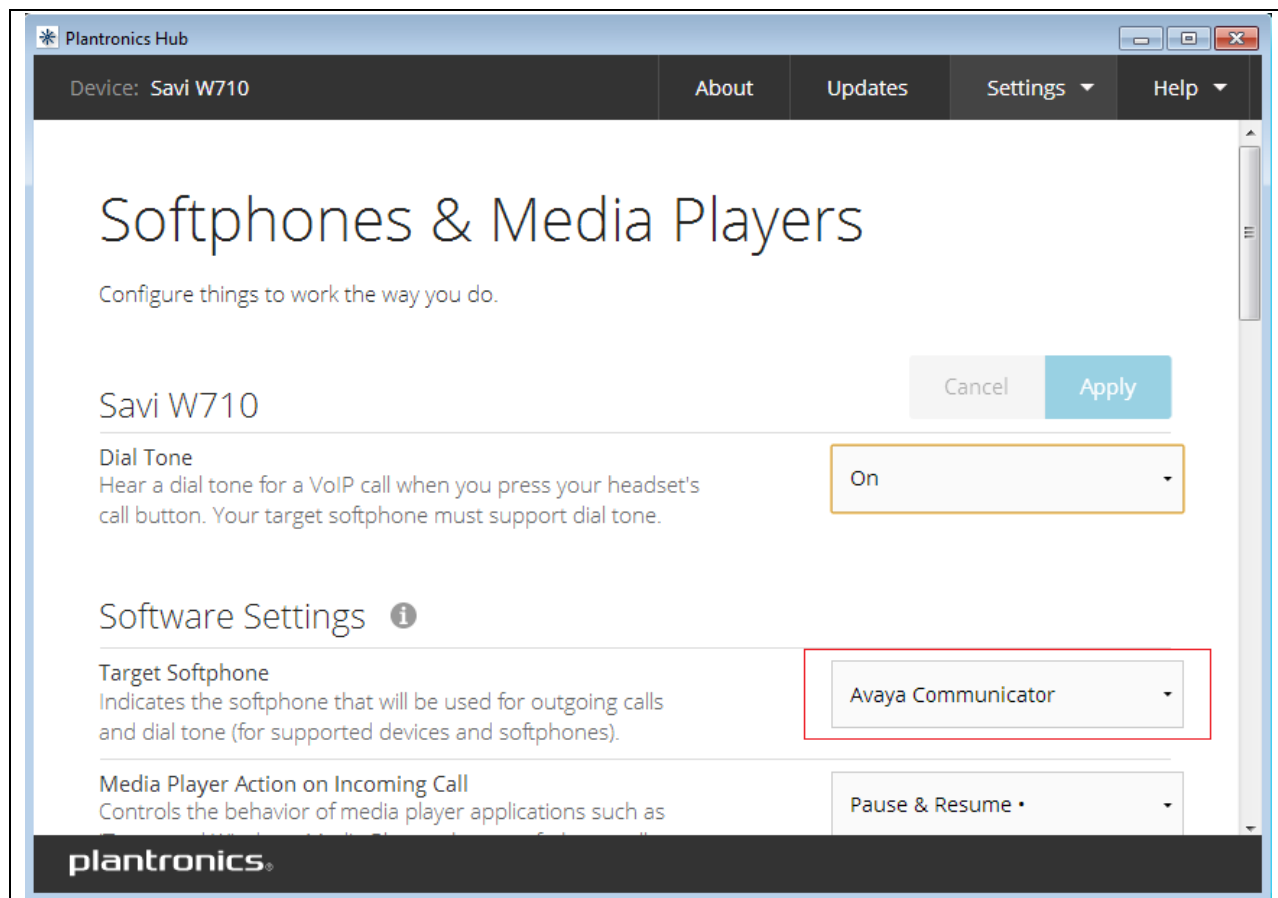

8. Verification Steps

From the Hub software installed, navigate to **Settings** → **Softphones**, scroll down to **Softphones & Media Players** section, and verify that the headset is connected to Avaya Communicator as shown in the screen below.

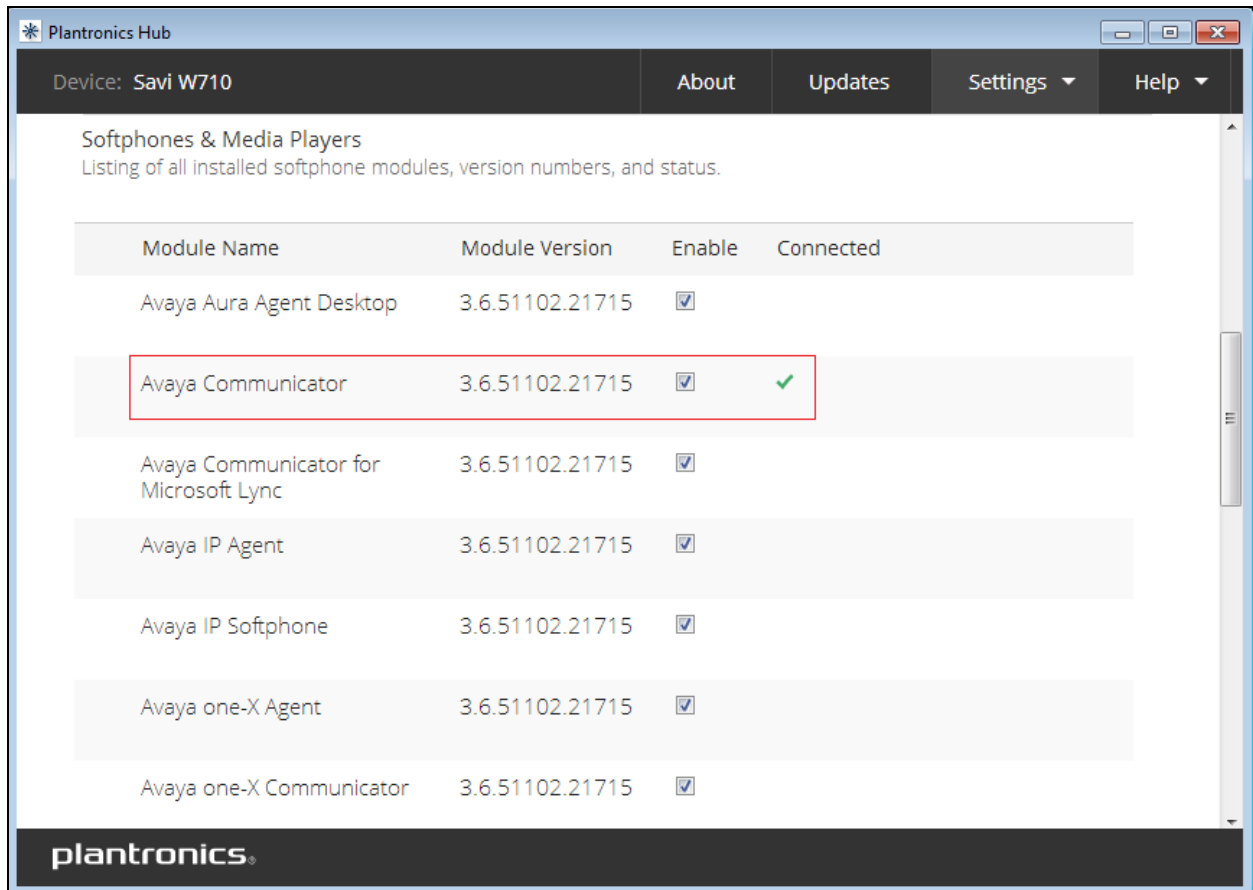

Also verify the following:

- The headset fully supports call control initiated from the headset.
- When the headset is connected to Avaya Communicator, press the handset button on the Communicator. The headset LED and the base station LED should be lit.
- When a call is disconnected by pressing the handset button on the Communicator, the call will be dropped and the headset LED and the base station LED should be shut off.
- Press the call control button on the headset. The LED on the headset and the base station LED will be lit.
- To end calls press the button on the headset. The active call will disconnect and the LED light on the headset and the base station will turn off.
- Verify if the volume up/down and mute/unmute button on the headset functions as intended.
- Verify that the Hold button on the Communicator function as intended.
- Verify that a call can be answered by pressing the call control button of the base station and also the same button can be used to terminate a call.

9. Conclusion

These Application Notes describe the configuration steps required for Plantronics Savi W710 Headset and Plantronics Hub software with Avaya Communicator for Windows. Please refer to **Section 2.2** for test results and observations if any.

10. Additional References

This section references the Avaya and Plantronics documentation that are relevant to these Application Notes.

The following Avaya product documentation can be found at <http://support.avaya.com>.

- [1] *Administering Avaya Aura® Communication Manager*, Document ID 03-300509
- [2] *Avaya Aura® Communication Manager Feature Description and Implementation*, Document ID 555-245-205
- [3] *Implementing Avaya Aura® Session Manager* Document ID 03-603473
- [4] *Administering Avaya Aura® Session Manager*, Doc ID 03-603324
- [5] *Using Avaya Communicator for Windows*, Release 2.1, 18-604158
- [6] *Administering Avaya Communicator for Android, iPad, iPhone, and Windows*, Release 2.1

The Plantronics product documentation can be found at <http://www.plantronics.com>.

©2016 Avaya Inc. All Rights Reserved.

Avaya and the Avaya Logo are trademarks of Avaya Inc. All trademarks identified by ® and ™ are registered trademarks or trademarks, respectively, of Avaya Inc. All other trademarks are the property of their respective owners. The information provided in these Application Notes is subject to change without notice. The configurations, technical data, and recommendations provided in these Application Notes are believed to be accurate and dependable, but are presented without express or implied warranty. Users are responsible for their application of any products specified in these Application Notes.

Please e-mail any questions or comments pertaining to these Application Notes along with the full title name and filename, located in the lower right corner, directly to the Avaya DevConnect Program at devconnect@avaya.com.