



Avaya Solution & Interoperability Test Lab

Application Notes for Configuring EPOS Connect and ADAPT 100 Series Headsets with Avaya Workplace Client for Mac - Issue 1.0

Abstract

These Application Notes describe the configuration steps required to integrate EPOS Connect and ADAPT 100 Series headsets with Avaya Workplace Client for Mac.

Readers should pay attention to **Section 2**, in particular the scope of testing as outlined in **Section 2.1** as well as any observations noted in **Section 2.2**, to ensure that their own use cases are adequately covered by this scope and results.

Information in these Application Notes has been obtained through DevConnect compliance testing and additional technical discussions. Testing was conducted via the DevConnect Program at the Avaya Solution and Interoperability Test Lab.

1. Introduction

The EPOS ADAPT 100 Series headsets with EPOS Connect software allows connectivity to Avaya Workplace Client for Mac (hereafter referred to as Avaya Workplace) via USB interface on the PC.

The following EPOS ADAPT 100 Series headsets were used for compliance testing.

- EPOS ADAPT 165 II USB-C
- EPOS ADAPT 130 II USB-C
- EPOS ADAPT 160 ANC USB

Note: See the EPOS Declaration of Compliance, **Attachment 1**, which provides details of other EPOS ADAPT 100 Series models for which this testing applies. For additional information contact EPOS support as shown in **Section 2.3**.

2. General Test Approach and Test Results

The interoperability compliance test included feature and serviceability testing. The feature testing focused on placing calls with Avaya Workplace, answering, and ending calls using the call control button on the EPOS headset, and verifying two-way audio. The call types include calls to voicemail, local extensions, and the PSTN. Call hold and resume, mute and un-mute, and volume are also tested.

The serviceability testing focused on verifying the usability of the EPOS headset solution after restarting the Avaya Workplace, restarting the PC, and reconnecting the headset via USB to the PC.

Avaya recommends our customers implement Avaya solutions using appropriate security and encryption capabilities enabled by our products. The testing referenced in these DevConnect Application Notes included the enablement of supported encryption capabilities in the Avaya products. Readers should consult the appropriate Avaya product documentation for further information regarding security and encryption capabilities supported by those Avaya products.

Support for these security and encryption capabilities in any non-Avaya solution component is the responsibility of each individual vendor. Readers should consult the appropriate vendor-supplied product documentation for more information regarding those products.

For the testing associated with these Application Notes, the interface between Avaya systems and endpoints utilized enabled capabilities of TLS/SRTP.

DevConnect Compliance Testing is conducted jointly by Avaya and DevConnect members. The jointly-defined test plan focuses on exercising APIs and/or standards-based interfaces pertinent to the interoperability of the tested products and their functionalities. DevConnect Compliance Testing is not intended to substitute full product performance or feature testing performed by DevConnect members, nor is it to be construed as an endorsement by Avaya of the suitability or completeness of a DevConnect member's solution.

Avaya's formal testing and Declaration of Conformity is provided only on the headsets/handsets that carry the Avaya brand or logo. Avaya may conduct testing of non-Avaya headset/handset to determine interoperability with Avaya phones. However, Avaya does not conduct the testing of non-Avaya headsets/handsets for: Acoustic Pressure, Safety, Hearing Aid Compliance, EMC regulations, or any other tests to ensure conformity with safety, audio quality, long-term reliability or any regulation requirements. As a result, Avaya makes no representations whether a particular non-Avaya headset will work with Avaya's telephones or with a different generation of the same Avaya telephone.

Since there is no industry standard for handset interfaces, different manufacturers utilize different handset/headset interfaces with their telephones. Therefore, any claim made by a headset vendor that its product is compatible with Avaya telephones does not equate to a guarantee that the headset will provide adequate safety protection or audio quality.

2.1. Interoperability Compliance Testing

All test cases were performed manually. The following features were verified:

- Placing calls to the voicemail system. Voice messages were recorded and played back to verify that the playback volume and recording level were good.
- Placing calls to internal extensions to verify two-way audio.
- Placing calls to the PSTN to verify two-way audio.
- Answering and ending calls using the call button on the headset and the soft button on Avaya Workplace.
- Using the soft button on Avaya Workplace to hold and resume the audio.
- Using the volume buttons on the headset to adjust the audio volume.
- Using the mute button on the headset and the soft button on Avaya Workplace to mute and un-mute the audio.
- Verifying incoming call notification.
- Verifying call ended notification.

The serviceability testing focused on verifying the usability of the headset solution after restarting the Avaya Workplace, restarting the PC, and reconnecting the headset via USB to the PC.

2.2. Test Results

The following issue was observed during the compliance testing:

- EPOS ADAPT 100 Series headsets does not support Call Control (answering and hanging-up calls) by using the headset with this solution. Only two-way audio, mute/unmute and volume control were verified successfully. Mute status is also not synchronized.

2.3. Support

For support on this EPOS headset solution, contact EPOS Technical Support below where sign-in is required:

- Website: <https://eposaudio.com/support/>

3. Reference Configuration

Figure 1 illustrates the test configuration used to verify the EPOS Connect and ADAPT 100 Series USB headsets with Avaya Workplace. The EPOS Connect software are installed on the PC together with Avaya Workplace. The EPOS headsets are connected via the PC's USB interface.

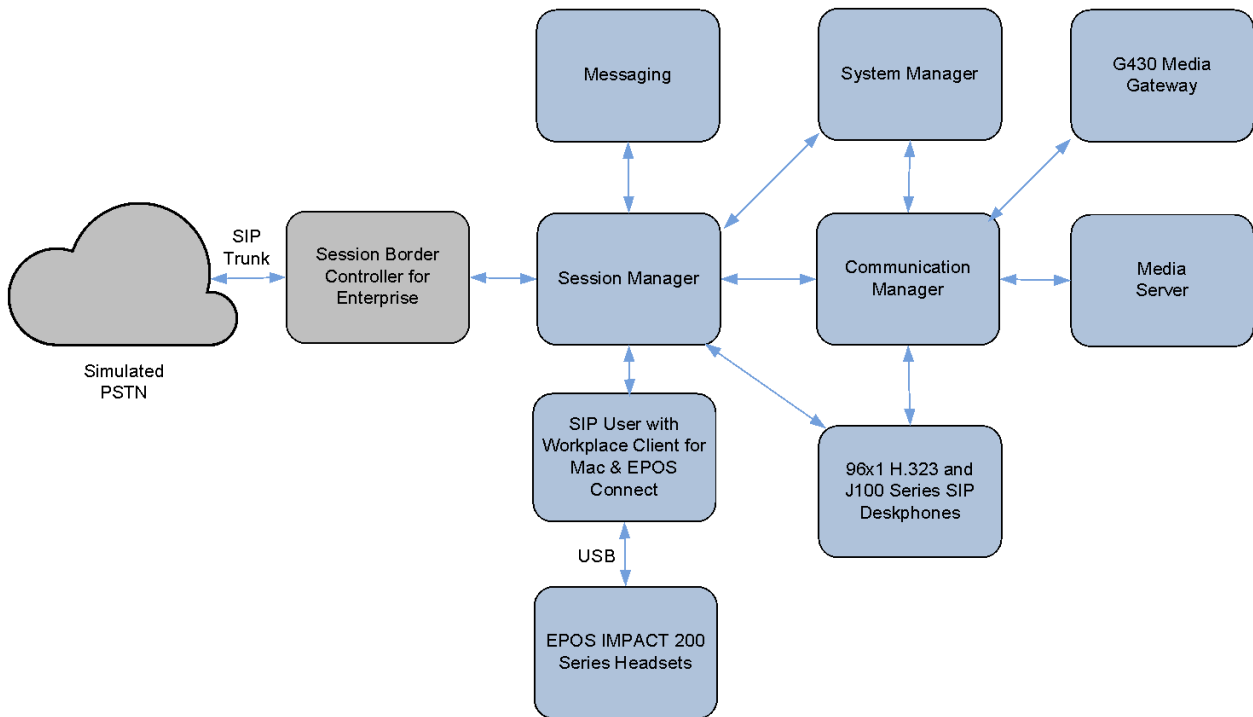


Figure 1: Test Configuration

4. Equipment and Software Validated

The following equipment and software were used for the sample configuration provided.

Equipment/Software	Release/Version
Avaya Aura® Communication Manager	10.1 SP2 (10.1.0.1.0.974.27607)
Avaya G430 Media Gateway	42.80
Avaya Aura® System Manager	10.1 SP2 Build 10.1.0.0.537353
Avaya Aura® Session Manager	10.1 SP2 (10.1.0.2.1010215)
Avaya Aura® Media Server	10.1.0.101
Avaya Messaging	10.8 SP1 SU2
Avaya 96x1 Series H.323 IP Deskphones	6.853
Avaya J100 Series SIP IP Phones	4.0.13
Avaya Workplace Client for Mac running on macOS Monterey v12.6	3.29
EPOS ADAPT 100 Series <ul style="list-style-type: none">EPOS ADAPT 165 II USB-CEPOS ADAPT 130 II USB-CEPOS ADAPT 160 ANC USB	v8.41.38.0
EPOS Connect for Mac	7.3.2.35483


5. Configure Avaya Aura® Communication Manager




The addition of SIP User for use by Avaya Workplace will not be detailed here. Refer to details in adding user in the administration document for Avaya Aura® Session Manager in Error! Reference source not found. listed in **Section 10** for details.


6. Configure Avaya Workplace Client for Mac

Avaya Workplace is a SIP soft phone application that provides users with access to Unified Communications (UC) services. This section shows how to configure the EPOS ADAPT 100 Series to use with Avaya Workplace.

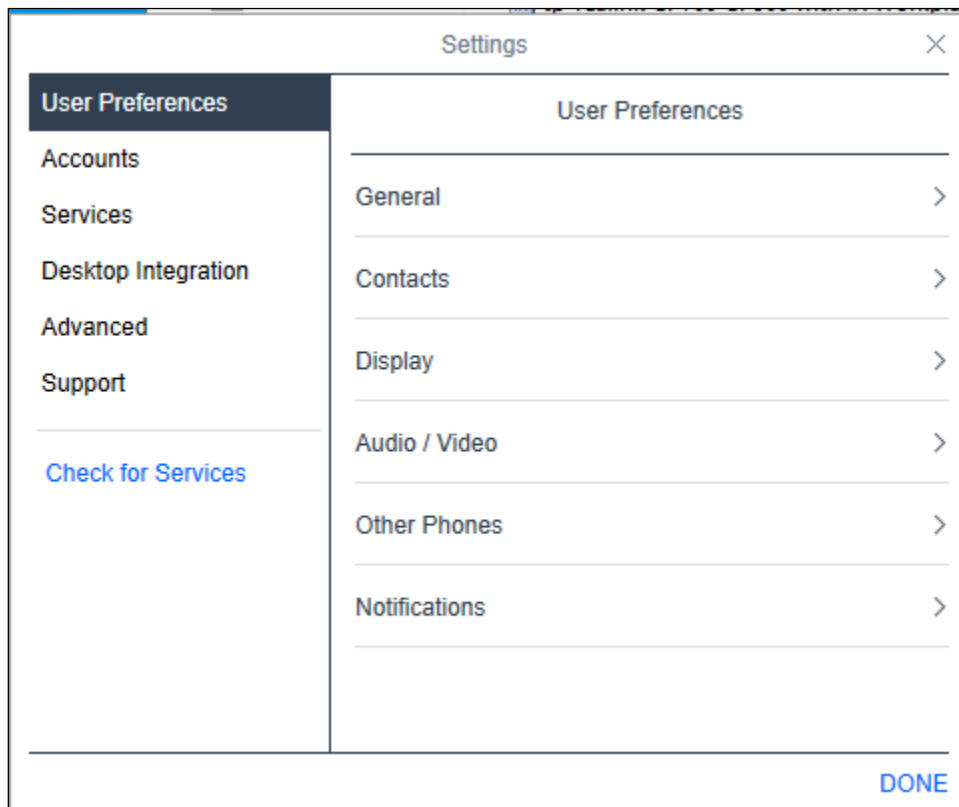Before configuring Avaya Workplace, the headset has to be configured and provisioned as in **Section 7** first. From Avaya Workplace, navigate to **Settings** → **User Preferences** → **Audio/Video**.



Select *EPOS ADAPT 160 ANC* for **Microphone**  and the same for **Speakers**  as shown below. It is optional for ring notification on incoming calls  to be set as *EPOS ADAPT 160 ANC*.

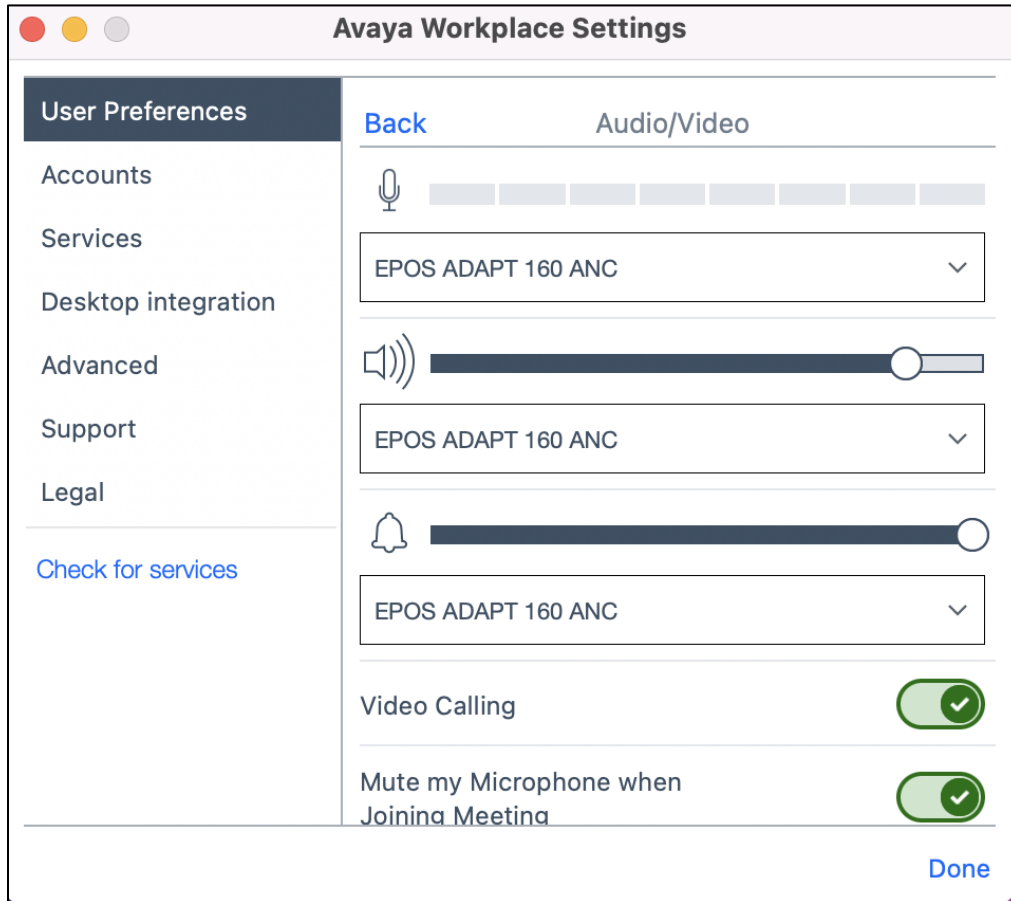

7. Configure EPOS ADAPT 100 Series USB-A/C Headset

This section covers the steps to integrate EPOS ADAPT 100 Series headset with Avaya Workplace, including:

- Installing the EPOS Connect software
- Connect the EPOS headset
- Configuring EPOS headset with EPOS Connect

Note: After successfully performing this procedure, the EPOS headset will be detected in Avaya Workplace as described in **Section 6**.


7.1. Installing the EPOS Connect Software

EPOS Connect software can be obtained from the EPOS support portal at <https://eposaudio.com/support/>. Installation of the software is done by executing the .exe file and following the prompt.

7.2. Connect the EPOS headset


Plug the EPOS ADAPT 160 ANC headset into the USB port of the PC. The device drivers will automatically be installed.

Open the EPOS program installed on the PC. Select the **Home** icon and check that the headset is detected as shown below for ADAPT 160 ANC headset tested.

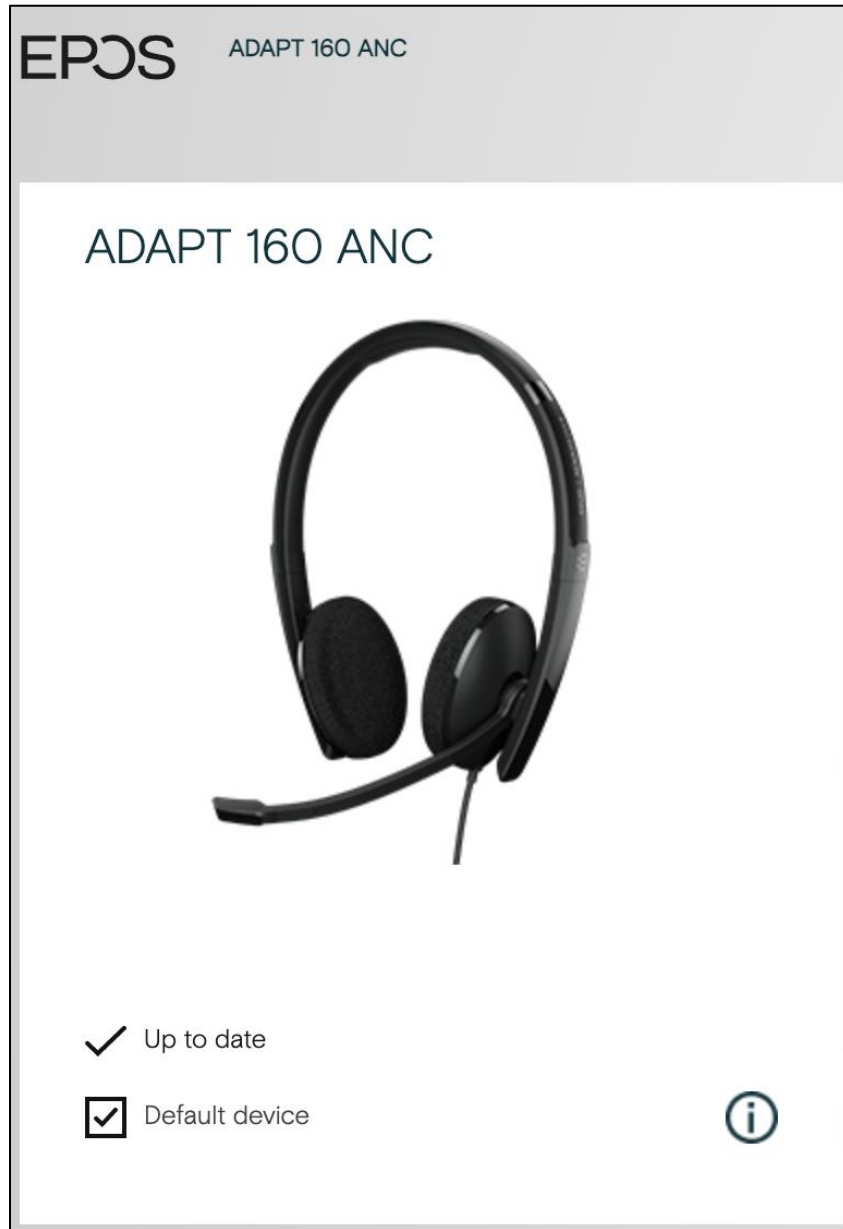

7.3. Configuring EPOS headset with EPOS Connect

Open the Avaya Workplace and click the EPOS Connect program **Settings** wheel icon from the bottom of the home screen. Verify the **Default Headset** is properly detected. Check that the **Default Softphone** is set as **Avaya Workplace**. Otherwise, click the drop-down menu to select. Click **Save Settings** at the bottom right to retain it.

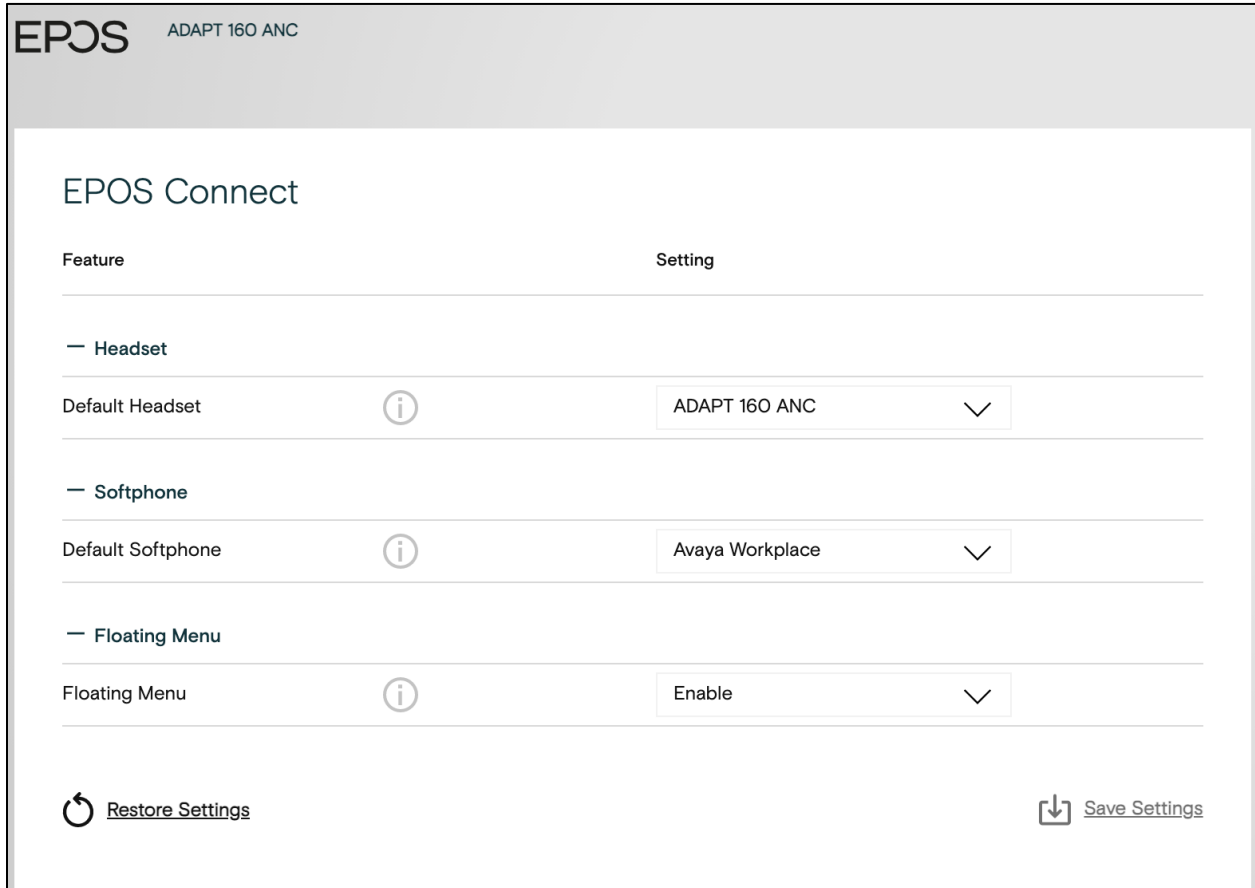

8. Verification Steps

This section verifies that the EPOS solution has been properly integrated with Avaya Workplace.

1. Open the EPOS Connect program to verify that the headset has been successfully connected to the PC for use with Avaya Workplace running. Observe that EPOS ADAPT 100 Series headset is detected as detailed in **Section 7.2**.
2. Make incoming and outgoing calls and verify that calls can be established with two-way audio. For incoming calls, answer the call by pressing the call control button on the headset (see inline controller as shown below).
3. End the call by pressing the same call control button on the headset.
4. Verify that remote call functions, such as mute/un-mute, and adjusting the volume can also be performed by pressing the relevant keys on the headset inline controller. Similarly, verify that the same call control functions can also be performed using Avaya Workplace.

Note that as observed in **Section 2.2**, call control function is not supported with the version of EPOS Connect and headset firmware tested.



9. Conclusion

These Application Notes describe the configuration steps required to integrate EPOS Connect and EPOS ADAPT 100 Series headsets with Avaya Workplace Client for Mac. All test cases were completed with observations noted in **Section 2.2**.

10. Additional References

This section references the Avaya and EPOS documentation that are relevant to these Application Notes.

The following Avaya product documentation can be found at <http://support.avaya.com>.

[1] *Administering Avaya Aura® Communication Manager*, Release 10.1.x, Issue 5, March 2023.

[2] *Administering Avaya Aura® Session Manager*, Release 10.1, Issue 4, September 2022.

[3] *Planning for and Administering Avaya Workplace Client for Android, iOS, Mac, and Windows*, 6 Jan 2023.

[4] *Using Avaya Workplace Client for Android, iOS, Mac, and Windows*, 6 Jan 2023.

The following EPOS documentation can be found at <http://www.eposaudio.com>.

[5] *EPOS ADAPT 130 160 USB II Quick Guide*.

©2023 Avaya Inc. All Rights Reserved.

Avaya and the Avaya Logo are trademarks of Avaya Inc. All trademarks identified by ® and ™ are registered trademarks or trademarks, respectively, of Avaya Inc. All other trademarks are the property of their respective owners. The information provided in these Application Notes is subject to change without notice. The configurations, technical data, and recommendations provided in these Application Notes are believed to be accurate and dependable, but are presented without express or implied warranty. Users are responsible for their application of any products specified in these Application Notes.

Please e-mail any questions or comments pertaining to these Application Notes along with the full title name and filename, located in the lower right corner, directly to the Avaya DevConnect Program at devconnect@avaya.com.

EPOS Group A/S
 Industriparken 27,
 DK-2750 Ballerup, Denmark
 eposaudio.com

Declaration of Compliance

We, EPOS Group A/S, declare under sole responsibility that within EPOS ADAPT 100 series there are more variants that have similar features, differences affecting only the wearing style and connectivity.

These differences have no other impact on firmware (FW) functionality. These schematics of RF board is 100% the same. The firmware version is also the same. The attached headsets which define the acoustics are 100% the same.

		USB & Smartphone / Tablet connectivity
Product sales name		ADAPT 130 USB II / ADAPT 130 USB-C II On-ear, single-sided USB-A / USB-C headset with foam earpads ADAPT 160 USB II / ADAPT 160 USB-C II On-ear, double-sided USB-A / USB-C headset with foam earpads ADAPT 135 USB II / ADAPT 135 USB-C II On-ear, single-sided USB-A / USB-C headset with leatherette earpads ADAPT 165 USB II / ADAPT 165 USB-C II On-ear, double-sided USB-A / USB-C headset with leatherette earpads
Product similarities		Firmware version RF PCBA Schematic Acoustical design
Differences	Wearing style	Single vs Double sided headset
	Materials	Foam earpads (ADAPT 130, ADAPT 160) leatherette earpads (ADAPT 135, ADAPT 165)
	Connectivity	USB-A / USB-C
connection method to Avaya Workplace Client for MacOS		USB-A / USB-C direct

2023-03-31

X Michael Aaslund

Michael Aaslund
 Director Strategic Alliances, Product Manag...
 Signed by: Michael Aaslund (MCAU)

EPOS Group A/S
Industriparken 27,
DK-2750 Ballerup, Denmark
eposaudio.com

Appendix 1. Images displaying the differences

ADAPT 130 USB-C II / ADAPT 130 USB II



ADAPT 160 USB-C II / ADAPT 160 USB II



EPOS Group A/S
Industriparken 27,
DK-2750 Ballerup, Denmark
eposaudio.com

ADAPT 135 USB-C II / ADAPT 135 USB II



ADAPT 165 USB-C II / ADAPT 165 USB II



EPOS

EPOS Group A/S
Industriparken 27,
DK-2750 Ballerup, Denmark
eposaudio.com