



## Avaya Solution & Interoperability Test Lab

---

# Application Notes for Aiphone IX Series Audio Door Stations (IX-SSA) and Avaya IP Office™ – Issue 1.0

### Abstract

These Application Notes describe the procedures for configuring Aiphone IX Series Audio Door Stations (IX-SSA) which were compliance tested with Avaya IP Office™.

The overall objective of the interoperability compliance testing was to verify Aiphone IX Series Audio Door Stations (IX-SSA) functionalities in an environment comprised of Avaya IP Office™ and various Avaya endpoints. Aiphone IX Series Audio Door Stations are SIP based door phones.

Readers should pay attention to **Section** Error! Reference source not found., in particular the scope of testing as outlined in **Section** Error! Reference source not found. as well as any observations noted in **Section** Error! Reference source not found., to ensure that their own use cases are adequately covered by this scope and results.

Information in these Application Notes has been obtained through DevConnect compliance testing and additional technical discussions. Testing was conducted via the DevConnect Program at the Avaya Solution and Interoperability Test Lab.

## 1. Introduction

These Application Notes describe the configuration steps required for Aiphone IX Series Audio Door Stations (IX-SSA) to interoperate with Avaya IP Office (IP Office). During the compliance testing, Aiphone IX-SSA was used.

The Aiphone IX Series Audio Door Stations (IX-SSA) are part of Aiphone IX Series 2 Door Stations. The Audio Door Stations act as SIP phones when connected to IP Office. Stations come in both surface mount and flush mount varieties, please see **Appendix A** regarding various versions of IX-SSA devices. All door stations have dry contacts that can be used to release doors when activated by another intercom or phone. The dry contacts can also be used to trigger external signaling devices, such as strobes.

During the compliance test, Avaya IP Office Server Edition was used as a primary system and Avaya IP Office 500V2 as an expansion system. Aiphone IX-SSA registered as a 3<sup>rd</sup> party SIP phone using UDP to the Avaya IP Office Server Edition.

## 2. General Test Approach and Test Results

The focus of this interoperability compliance testing was to verify that the Aiphone IX-SSA can register as a SIP endpoint on IP Office, and is able to originate and receive audio calls to and from the IP Office system.

DevConnect Compliance Testing is conducted jointly by Avaya and DevConnect members. The jointly-defined test plan focuses on exercising APIs and/or standards-based interfaces pertinent to the interoperability of the tested products and their functionalities. DevConnect Compliance Testing is not intended to substitute full product performance or feature testing performed by DevConnect members, nor is it to be construed as an endorsement by Avaya of the suitability or completeness of a DevConnect member's solution.

Avaya recommends our customers implement Avaya solutions using appropriate security and encryption capabilities enabled by our products. The testing referenced in these DevConnect Application Notes included the enablement of supported encryption capabilities in the Avaya products. Readers should consult the appropriate Avaya product documentation for further information regarding security and encryption capabilities supported by those Avaya products.

Support for these security and encryption capabilities in any non-Avaya solution component is the responsibility of each individual vendor. Readers should consult the appropriate vendor-supplied product documentation for more information regarding those products.

For the testing associated with these Application Notes, the interface between Avaya systems and Aiphone did not utilize secure capabilities.

## 2.1. Interoperability Compliance Testing

The general test approach was to place calls to and from, Aiphone IX-SSA, and exercise basic telephone operations. The main objectives were to verify the following:

- Registration
- Calls to/from Avaya SIP Audio endpoints
- Calls to/from Avaya H.323 Audio endpoints
- Calls to/from Avaya Digital & Analog endpoints
- Calls to/from PSTN via SIP Trunks
- Call termination (origination/destination)
- Serviceability

## 2.2. Test Results

The test objectives were verified, and the features tested worked as expected.

## 2.3. Support

For technical support on Aiphone IX-SSA, please contact Aiphone via the following:

### Japan

- Web: <https://www.aiphone.co.jp/>
- Phone: 052-228-9961

### USA, Canada

- Web: <https://www.aiphone.com/home>
- Email: tech@aiphone.com
- Phone: 800-692-0200

### France

- Web: <https://www.aiphone.fr/>
- Phone: 01 69 11 46 00

### Australia, New Zealand

- Web: <https://www.aiphone.com.au/>
- Phone: (02)80364507

### Singapore


- Web: <http://www.aiphone.com.sg/>
- Email: admin@aiphone.com.sg
- Phone: 6534-1135

### United Kingdom

- Web: <https://www.aiphone.co.uk/>
- Phone: 020-7507-6250

### 3. Reference Configuration

**Figure 1** illustrates a sample configuration consisting of Avaya IP Office components and Aiphone IX-SSA.

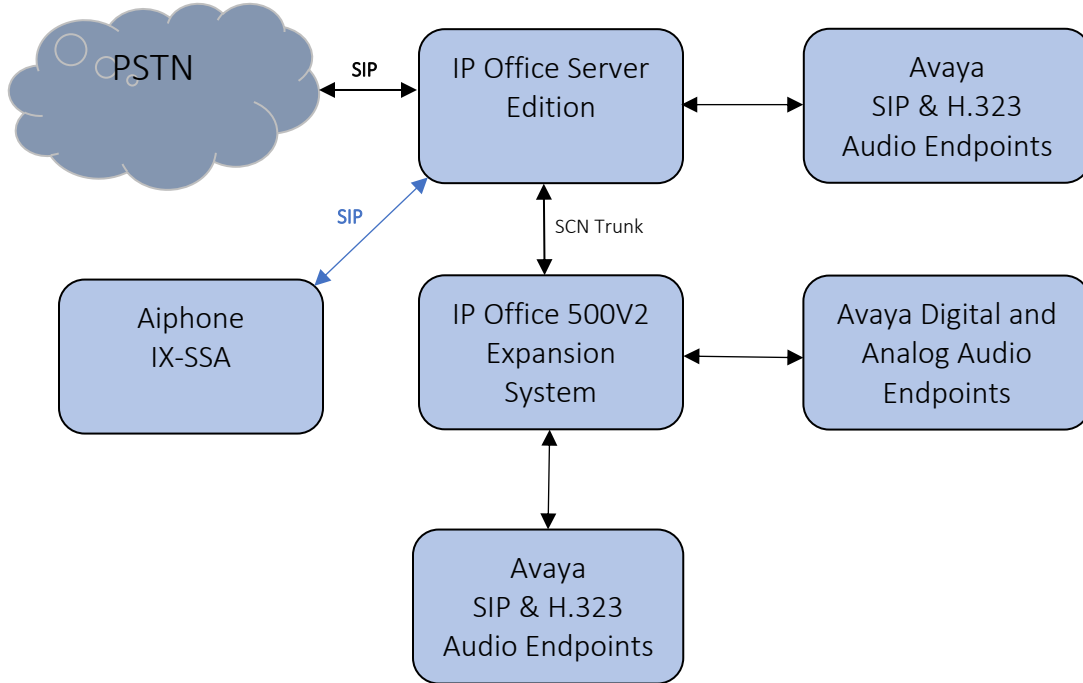

**Figure 1: Test Configuration of Aiphone IX-SSA with Avaya IP Office**

## 4. Equipment and Software Validated

The following equipment and software were used for the test configuration.

Equipment	Software/Firmware
Avaya IP Office Server Edition	11.0.4.0.0 build 74
Avaya IP Office 500V2	11.0.4.0.0 build 74
Avaya IP Office Manager	11.0.4.0.0 build 74
Avaya 9600 Series H.323 IP Deskphones	6.8002
Avaya J129 SIP Phone	4.0.0.0.21
Avaya IX Workspace	3.7.0.102.3
Avaya H175 Collaboration Station	1.0.2.3
Avaya Vantage K175 Phone	3.5.0
Avaya 9504 Digital Phone	0.55
Avaya 6210 Analogue Telephone	-
Aiphone IX Series Audio Door Station IX-SSA	3.00.

**Note:** Compliance Testing is applicable when the tested solution is deployed with a standalone IP Office 500 V2 and also when deployed with IP Office Server Edition in all configurations.

## 5. Configure Avaya IP Office™

This section provides the procedures for configuring IP Office. The procedures include the following areas:


- Verify IP Office license
- Obtain LAN IP address
- Administer SIP registrar
- Administer SIP extensions
- Administer SIP users

These steps are performed from the Avaya IP Office Manager.

### 5.1. Verify IP Office License

From a PC running the Avaya IP Office Manager application, select **Start → All Programs → IP Office → Manager** to launch the Manager application. Select the proper IP Office system if there are more than one IP Office system, and log in with the appropriate credentials.

The Avaya IP Office Manager screen is displayed. From the configuration tree in the left pane, select **License → 3<sup>rd</sup> Party IP Endpoints** to display available licenses in the right pane. Verify that the License Status field is set to **Valid** for **3<sup>rd</sup> Party IP Endpoints** feature.

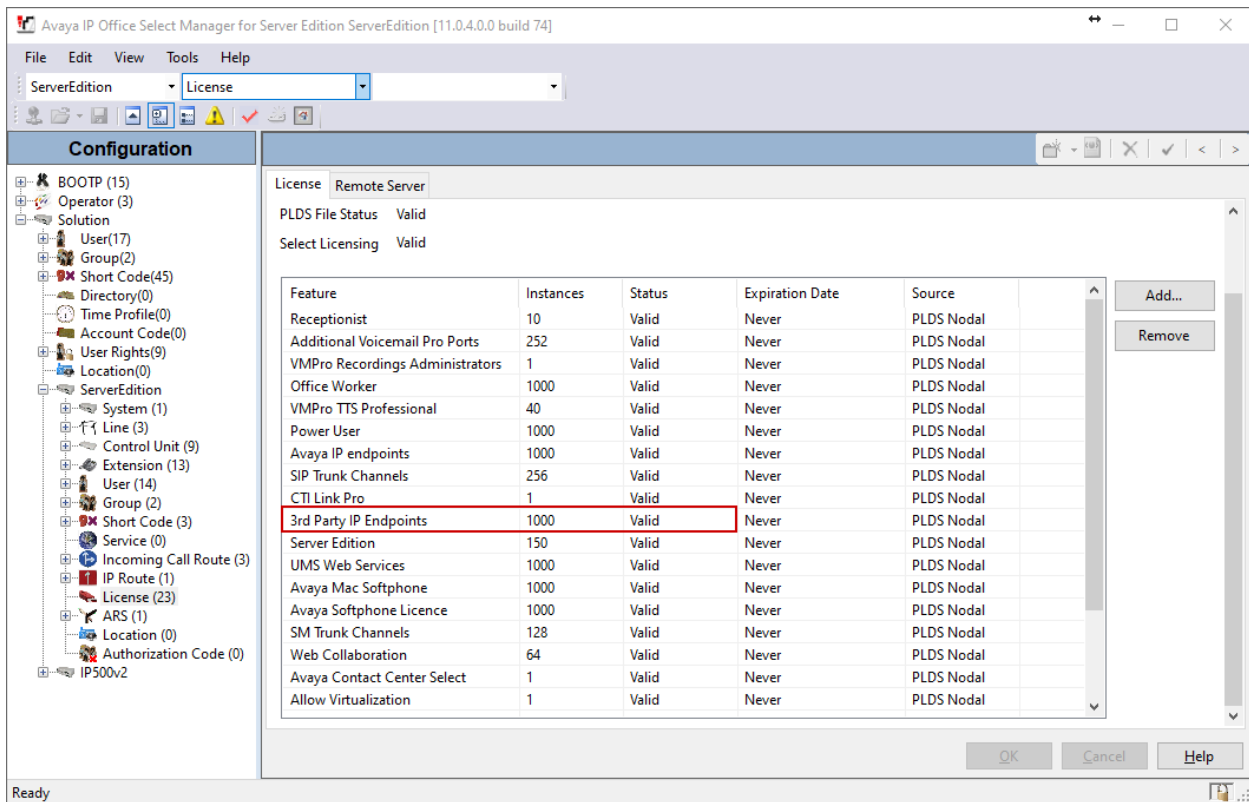


The screenshot shows the Avaya IP Office Select Manager for Server Edition application. The 'License' tab is selected, and the 'Remote Server' section is active. The 'PLDS File Status' is 'Valid' and 'Select Licensing' is 'Valid'. A table of features is displayed, with the '3rd Party IP Endpoints' feature highlighted in red. The table columns are Feature, Instances, Status, Expiration Date, and Source.

Feature	Instances	Status	Expiration Date	Source
Receptionist	10	Valid	Never	PLDS Nodal
Additional Voicemail Pro Ports	252	Valid	Never	PLDS Nodal
VMPro Recordings Administrators	1	Valid	Never	PLDS Nodal
Office Worker	1000	Valid	Never	PLDS Nodal
VMPro TTS Professional	40	Valid	Never	PLDS Nodal
Power User	1000	Valid	Never	PLDS Nodal
Avaya IP endpoints	1000	Valid	Never	PLDS Nodal
SIP Trunk Channels	256	Valid	Never	PLDS Nodal
CTI Link Pro	1	Valid	Never	PLDS Nodal
<b>3rd Party IP Endpoints</b>	<b>1000</b>	<b>Valid</b>	Never	PLDS Nodal
Server Edition	150	Valid	Never	PLDS Nodal
UMS Web Services	1000	Valid	Never	PLDS Nodal
Avaya Mac Softphone	1000	Valid	Never	PLDS Nodal
Avaya Softphone Licence	1000	Valid	Never	PLDS Nodal
SM Trunk Channels	128	Valid	Never	PLDS Nodal
Web Collaboration	64	Valid	Never	PLDS Nodal
Avaya Contact Center Select	1	Valid	Never	PLDS Nodal
Allow Virtualization	1	Valid	Never	PLDS Nodal


## 5.2. Obtain LAN IP Address

From the configuration tree in the left pane, select **System** to display the System screen in the right pane. Select the **LAN1** tab, followed by the **LAN Settings** sub-tab in the right pane. Make a note of the **IP Address**, which will be used later to configure Aiphone IX-SSA.

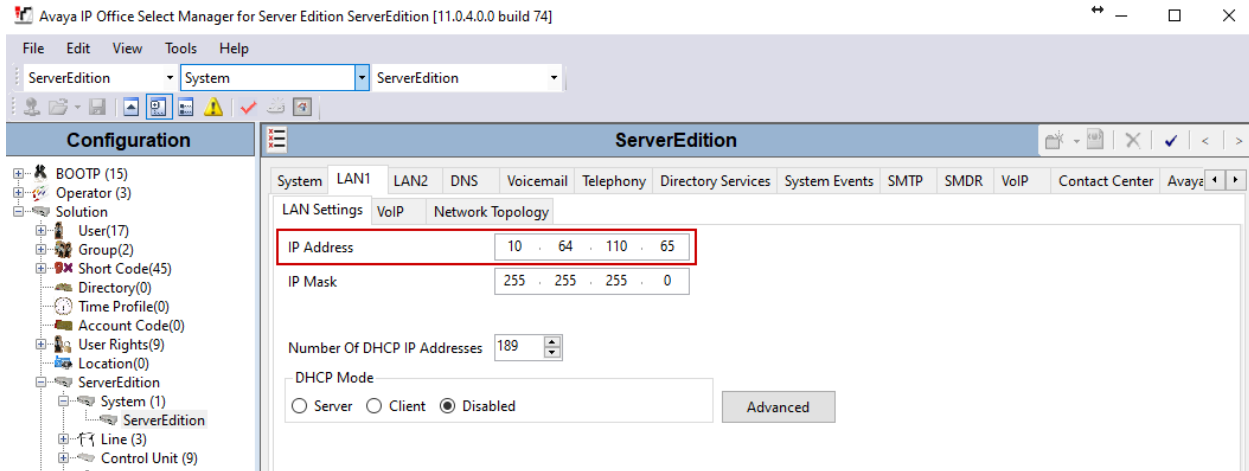


## 5.3. Administer SIP Registrar

Continuing from above, select the **VoIP** sub-tab. Ensure that **SIP Registrar Enable** is checked, as shown below.

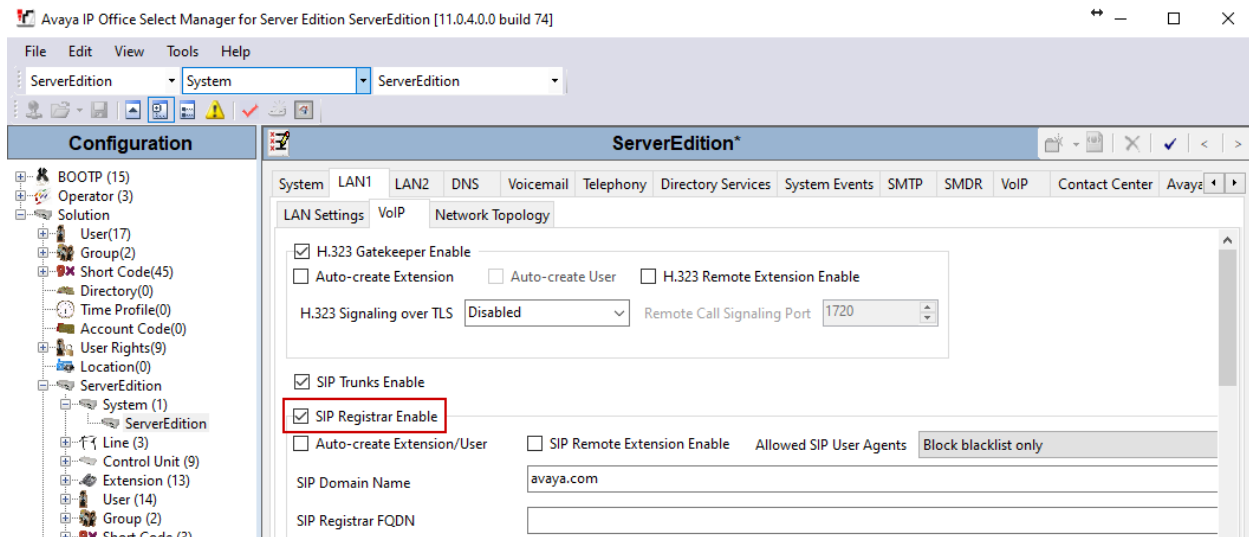

## 5.4. Administer SIP Extensions


To create a new SIP Extension, from the configuration tree in the left pane, right-click on **Extension**, and select **New → SIP Extension** from the pop-up list (not shown). Enter desired digits for the **Base Extension** field. This is the Extension that will be used for Aiphone IX-SSA to log in.

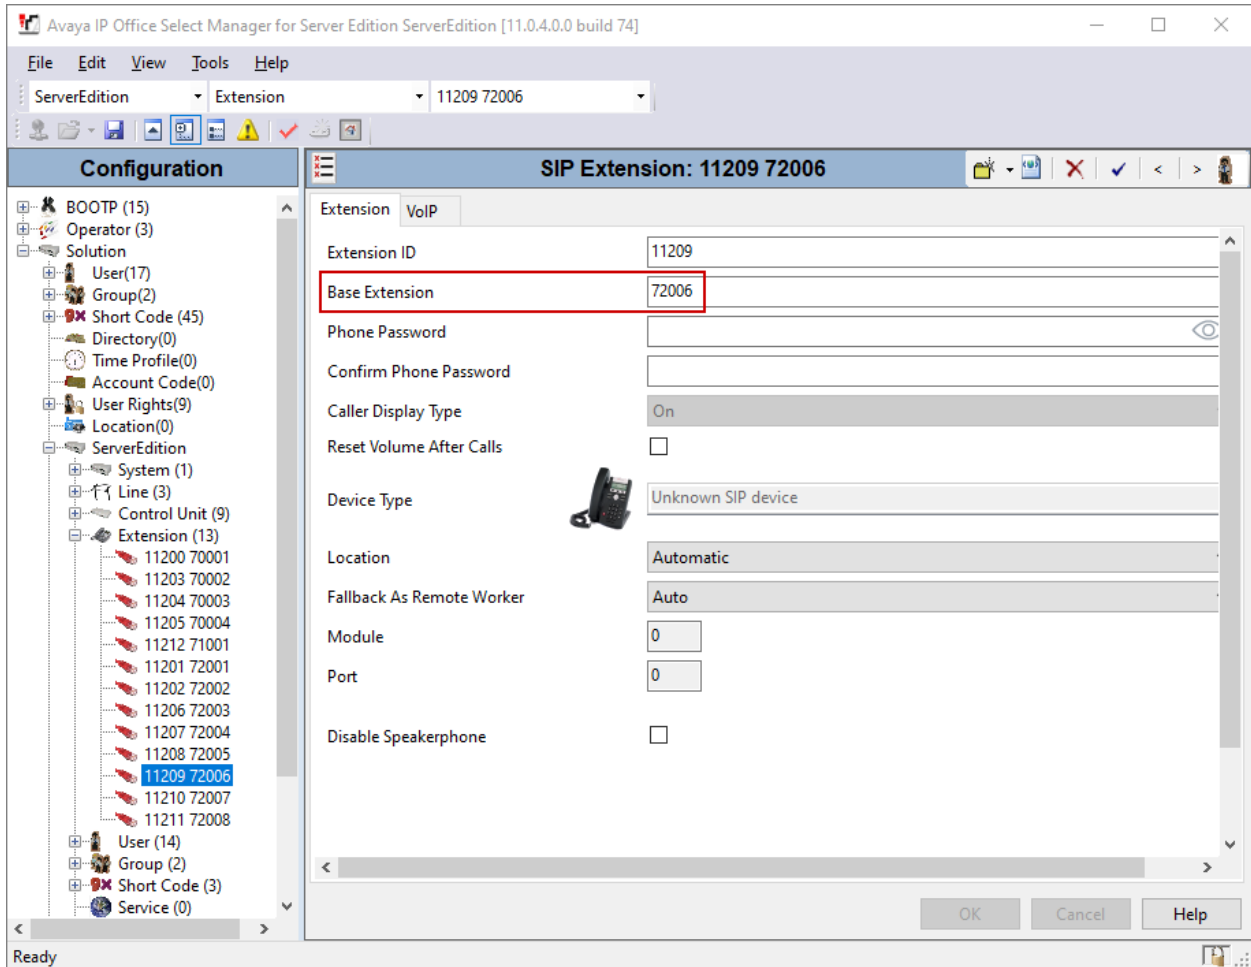




## 5.5. Administer SIP Users

To create a new SIP User, from the configuration tree in left pane, right-click on **User**, and select **New** from the pop-up list (not shown). Enter desired values for the **Name** field. For the **Extension** field, enter the SIP extension created in **Section 5.4**.

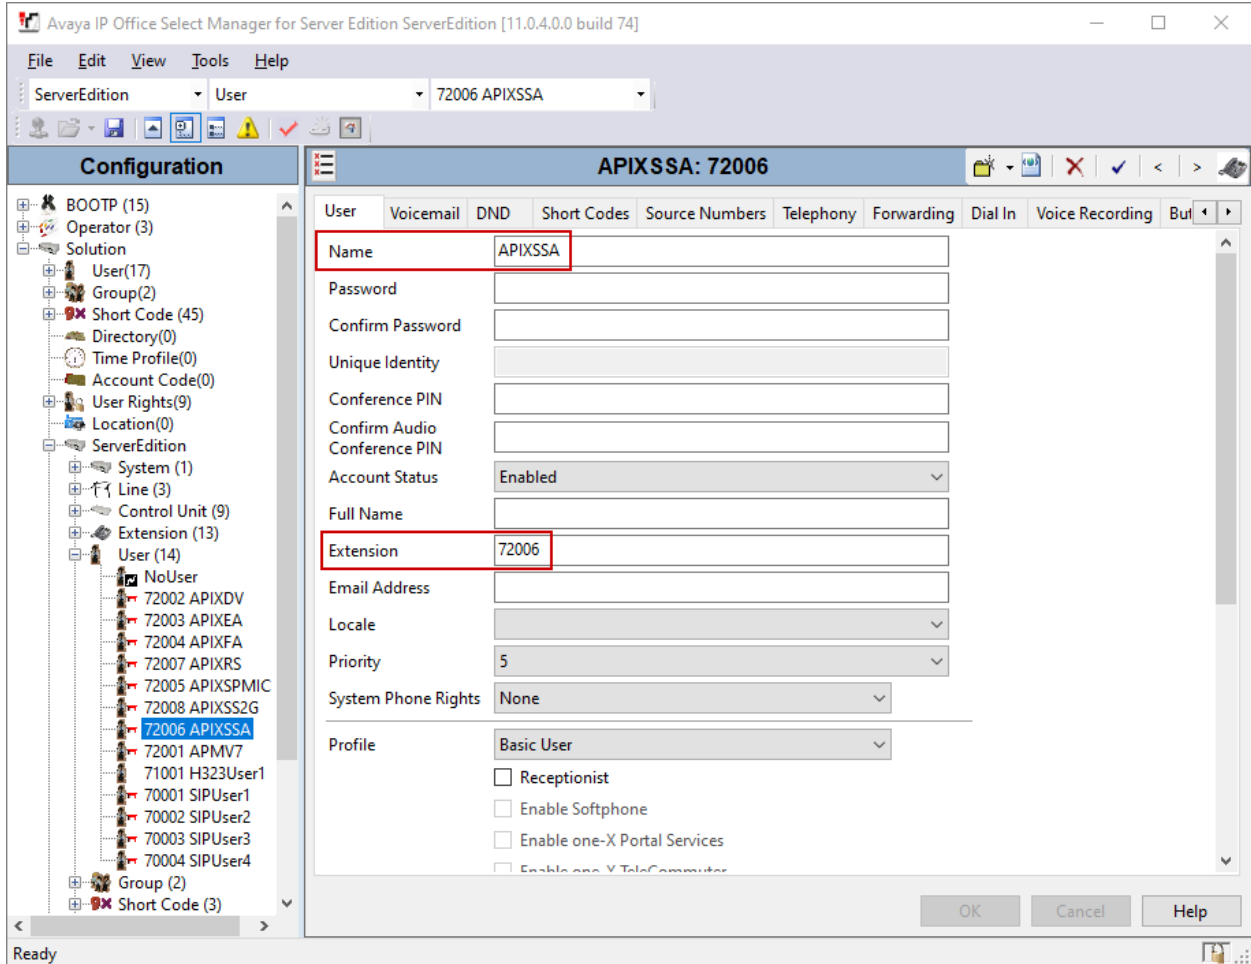


Select the **Supervisor Settings** tab, and enter a desired **Login Code** and **Confirm Login Code**. This code will be used as a password for Aiphone IX-SSA.

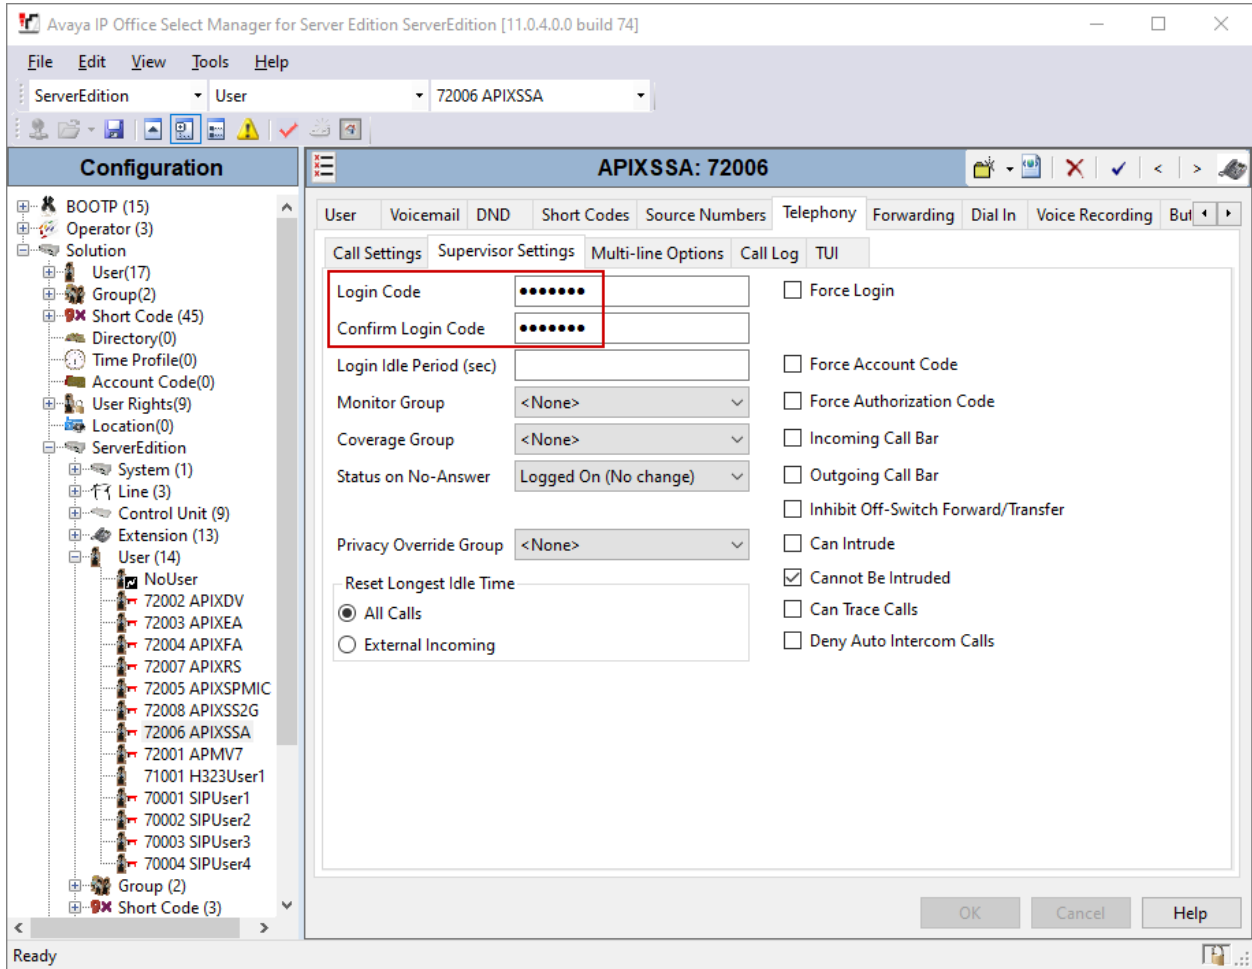

## 6. Configure Aiphone IX Series Audio Door Station

This section provides steps to configure Aiphone IX-SSA.

To configure Aiphone IX-SSA, using a web browser, navigate to <https://<IP Address of IX-SSA>/webset.cgi?login> and log in using appropriate credentials.

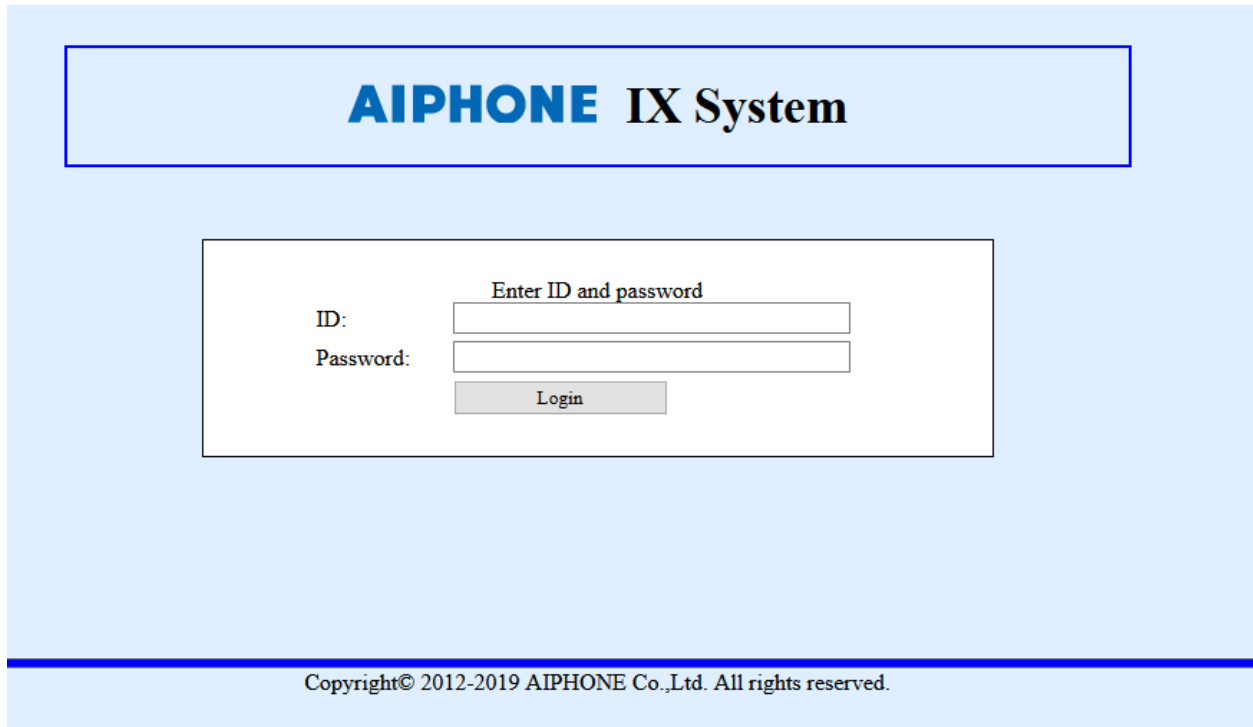

**AIPHONE IX System**

Enter ID and password

ID:

Password:

Login

Copyright© 2012-2019 AIPHONE Co.,Ltd. All rights reserved.

Once logged in, for the **Number** field, type in the SIP extension that is being configured (from **Section 5.4**), and a desired **Name**. Select **Update** to save change.

**AIPHONE IX System Setting**  
 Category: Audio Stations Station Type: IX-SSA(\*) Update

**Station Information**

Identification  
 ID and Password  
 Language  
 Time  
 Expanded System

**Network Settings**

IP Address  
 DNS  
 SIP  
 Audio

**Station Information**

• Identification

Number*	72006	3-5 digits
Name	IX-SSA	1-24 alphanumeric characters
Location		1-24 alphanumeric characters

\* Required Setting

From the left, select **Network Settings** → **SIP** and configure as follows:

- **SIP Signaling Port:** Set to **5060**.
- **User Agent:** Type in a desired value.
- **ID:** SIP Extension number from **Section 5.4**.
- **Password:** SIP Extension password from **Section 5.4**.
- **IPv4 Address:** LAN IP Address of IP Office from **Section 5.2**.
- **Port:** Set to **5060**.

Once done, select **Update** to save changes.

**AIPHONE IX System Setting**  
 Category: Audio Stations Station Type: IX-SSA(\*) Update

**Network Settings**

• SIP

**SIP Connections**

SIP Signaling Port*	5060	1-65535
User Agent	IX-SSA	1-36 alphanumeric characters

**SIP Server**

Primary Server

ID	72006	1-24 alphanumeric characters
Password	*****	1-24 alphanumeric characters
IPv4 Address	10.64.110.65	1.0.0.1-223.255.255.254 or hostname(1-64 alphanu
IPv6 Address		::FF-0-FE-FFFF-FFFF-FFFF-FFFF-FFFF-FFFF-FFFF
Port*	5060	1-65535

From the left, select **Call Settings** → **Station Settings** and configure as follows:  
 The numbers configured here will be dialed when the button on the IX-SSA is pressed.

- **Station Number:** Type in an extension number on IP Office that will be called for a given line.
- **IPv4:** Type in the LAN IP Address from **Section 5.2**.
- **Station Type:** Set to **VoIP Phone**.

Select **Update** to save changes.

The screenshot shows the 'AIPHONE IX System Setting' web interface. The page title is 'Call Settings' and the category is 'Audio Stations'. The station type is 'IX-SSA(-)'. The left sidebar contains navigation links for Station Information, Network Settings, System Information, Call Settings, and Option Input / Relay. The main content area is titled 'Call Settings' and includes the following sections:

- Station Information:** Call Button Function is set to 'Call, Answer Call, End Communication'. A note states: "Cancel Call, End Communication" disabled when using Option Input call.
- Called Stations (for Door):** Option Input # is set to 'Group 01'.
- Help Text:**
  - Station Number must be 3-5 digits. (3-32 digits for VoIP Phone)
  - IPv4 must be 1.0.0.1-223.255.255.254 or hostname(1-64 alphanumeric characters).
  - IPv6 must be ::FF:0-FE:FF:FFFF:FFFF:FFFF:FFFF:FFFF or hostname(1-64 alphanumeric characters).
  - Enter SIP Primary Server IP address for VoIP Phone, set only one VoIP Phone per call group.
  - Station Type must be "VoIP Phone" when calling via SIP server.
  - U = Unicast, M = Multicast
- Table:** A table with 5 columns: #, Station Number, IPv4 Address, IPv6 Address, and Station Type. Row 1 is highlighted in green and contains the values: 1, 78001, 10.64.110.65, and VoIP Phone.

#	Station Number	IPv4 Address	IPv6 Address	Station Type
1	78001	10.64.110.65		VoIP Phone
2				
3				


## 7. Verification Steps

The following steps may be used to verify the configuration:

- From a PC running the Avaya IP Office Monitor application. The **Avaya IP Office SysMonitor** screen is displayed (not shown). Select **Status** → **SIP Phone Status** from the top menu. Verify the SIP extension added from **Section 5.4** is displayed and the Status is **SIP: Registered**.

Extn Num	User Num	Phone Type	Security	IP Address	Transport	User Agent	Licensed	SIP Options	Status
\$1.70001	70001	EQN_X_D...	disable	10.64.10.48	TCP	Avaya Communicator/3.0 (3.6.4.31...	Avaya Softph...	RU	SIP: Registered
70001	70001	J129 SIP	disable	10.64.10.224	TCP	Avaya J129 IP Phone 4.0.0.0.21 (21)	Avaya IP	RU	SIP: Registered
70002	70002	VANTAG...	disable	10.64.10.223	TCP	Avaya Communicator Android/3.5.0...	Avaya IP	RU	SIP: Registered
70003	70003	H175 SIP	disable	10.64.10.222	TCP	Avaya H175 Collaboration Station ...	Avaya IP	RU	SIP: Registered
72001	72001	SIP	disable	10.64.10.40	UDP	IX-MV7	3rd Party IP	RU	SIP: Registered
72002	72002	SIP	disable	10.64.10.41	UDP	IX-DV	3rd Party IP	RU	SIP: Registered
72003	72003	SIP	disable	10.64.10.43	UDP	IX-EA	3rd Party IP	RU	SIP: Registered
72004	72004	SIP	disable	10.64.10.44	UDP	IX-FA	3rd Party IP	RU	SIP: Registered
72005	72005	SIP	disable	10.64.10.45	UDP	IX-SPMIC	3rd Party IP	RU	SIP: Registered
72006	72006	SIP	disable	10.64.10.46	UDP	IX-SSA	3rd Party IP	RU	SIP: Registered
72007	72007	SIP	disable	10.64.10.49	UDP	IX-RS	3rd Party IP	RU	SIP: Registered
72008	72008	SIP	disable	10.64.10.42	UDP	IX-SS-2G	3rd Party IP	RU	SIP: Registered

- Place a call from Aiphone IX-SSA to an Avaya endpoint. The state of the call be viewed on a PC running the **Avaya IP Office System Status** application. Select **Extensions** → Aiphone IX-SSA extension.

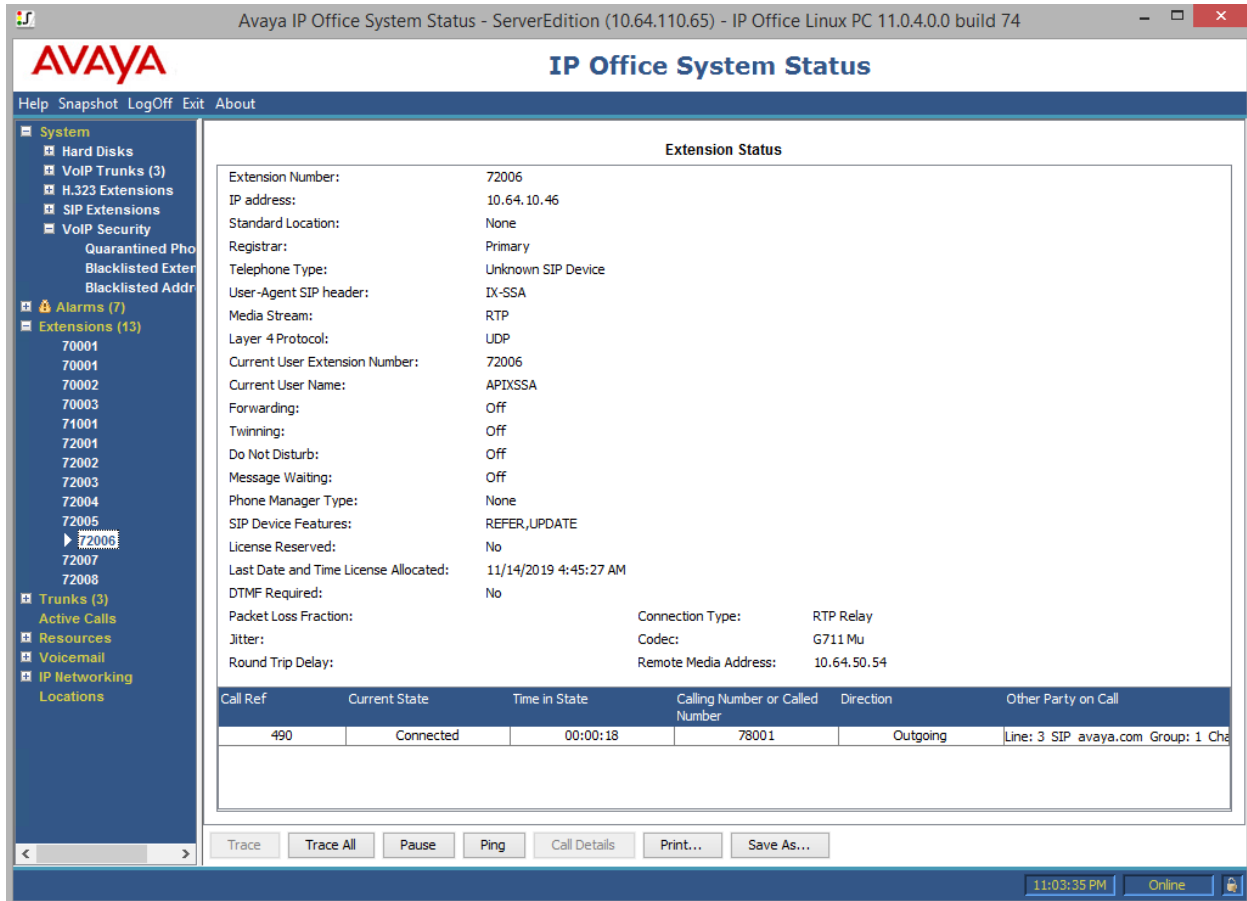

## 8. Conclusion

Aiphone IX-SSA was compliance tested with Avaya IP Office. Aiphone IX-SSA functioned properly for feature and serviceability.

## 9. Additional References

Avaya IP Office product documentation can be found at: <https://ipofficekb.avaya.com/>

Documentation related to Aiphone IX-SSA can be found at:

Japan: <https://www.aiphone.co.jp/products/business/ix/>

USA, Canada: <https://www.aiphone.com/home/products/ix-series>

France: <https://www.aiphone.fr/catalogue/interphonie-ip-protocole-sip-ix/>

Australia, New Zealand: <https://www.aiphone.com.au/product/ix/>

Singapore: <http://www.aiphone.com.sg/>

United Kingdom: [https://www.aiphone.co.uk/featured\\_item/ix2/](https://www.aiphone.co.uk/featured_item/ix2/)

## Appendix A

Following devices are based on the same firmware as IX-SSA:

- IX-SSA
- IX-SSA-RA
- IX-SSA-2RA
- IX-SSA-RA-FR
- IX-SSA-2RA-FR
- IXSSAL
- IXSSA2L

The difference in each IX devices is its attachment:

- IX-SSA
  - Flush mounting
- IX-SSA-RA
  - Flush mounting
  - Emergency button
- IX-SSA-2RA
  - Flush mounting
  - Emergency button
  - Normal call button
- IX-SSA-RA-FR
  - Flush mounting
  - Emergency call button
  - French notation
- IX-SSA-2RA-FR
  - Flush mounting
  - Emergency button
  - Normal call button
  - French notation
- IXSSAL
  - Flush mounting
  - Hearing aid
- IXSSA2L
  - Flush mounting
  - Hearing aid
  - 2 call buttons



---

**©2020 Avaya Inc. All Rights Reserved.**

Avaya and the Avaya Logo are trademarks of Avaya Inc. All trademarks identified by ® and ™ are registered trademarks or trademarks, respectively, of Avaya Inc. All other trademarks are the property of their respective owners. The information provided in these Application Notes is subject to change without notice. The configurations, technical data, and recommendations provided in these Application Notes are believed to be accurate and dependable, but are presented without express or implied warranty. Users are responsible for their application of any products specified in these Application Notes.

Please e-mail any questions or comments pertaining to these Application Notes along with the full title name and filename, located in the lower right corner, directly to the Avaya DevConnect Program at [devconnect@avaya.com](mailto:devconnect@avaya.com).